



Preliminary Information

PIP5496C Fuel Tank Hard To Fill Possible MIL With DTC P0446

Proactive


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2020	All	All	1.5L LYX and 2.0L LTG	All
GMC	Terrain	2018 - 2020	All	All	1.5L LYX and 2.0L LTG	All

Involved Region or Country	North America
Condition	Fuel tank hard to fill with fuel, evaporative emission canister saturated with fuel and possible DTC P0446.
Cause	Vent hose disconnected from fuel pump module assembly inside fuel tank.

Correction:

Reconnect fuel vent hose to fuel pump module inside fuel tank. Reference picture below showing properly connected fuel vent hose.

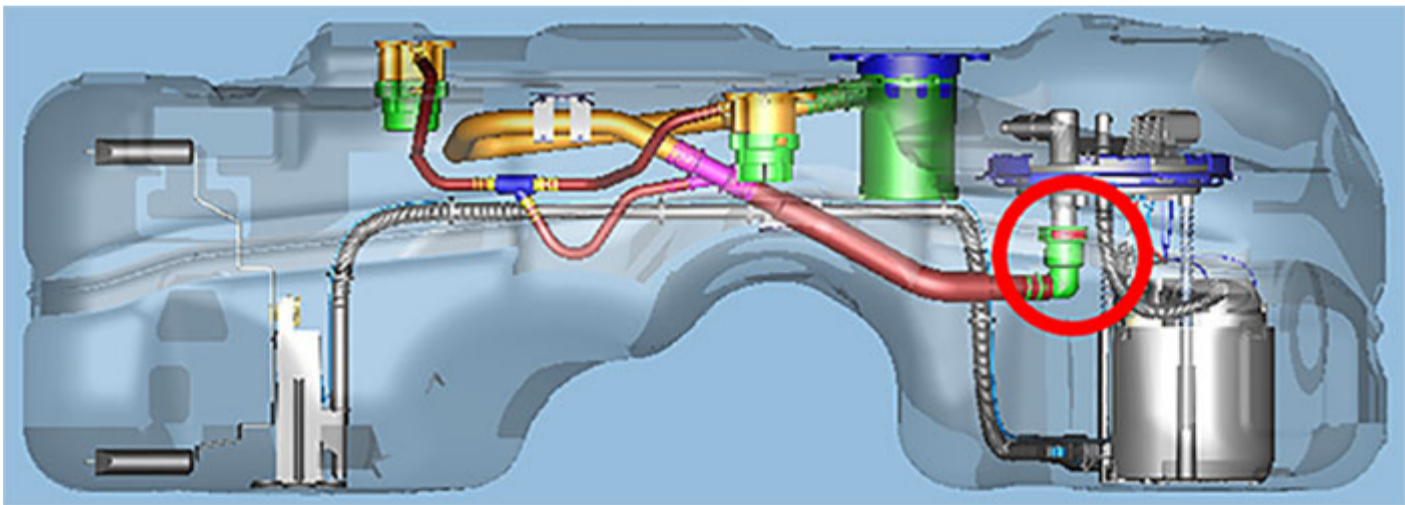

Also inspect evaporative emission canister for fuel saturation and replace canister as needed.

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4028730	Fuel Pump Module replacement	Use Published Labor Time

Labor Operation	Description	Labor Time
4027950	Evaporative Emission Canister Replacement	Use Published Labor Time

Version History

Version	4
Modified	<p>05/03/2017 - Created on.</p> <p>10/17/2017 Update to include 2018 GMC Terrain and 2.0 LTG</p> <p>10/17/2019 Updated to include 2019 and 2020 model years</p> <p>06/14/2021 Updated to clarify warranty statement is emissions</p>



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.