

## **SSM 50097 - 2016-2017 Various Vehicles - Body Control Module Programming Error**

Some 2016-2017 Ford and Lincoln vehicles with a new body control module (BCM) installed may exhibit a programming error when using IDS versions 122.03 through 123.01 stating 'Data Corrupt' or 'Configuration Failed,' would you like to retry?'. IDS scan tool version 123.02 contains a fix for this programming error. Install IDS version 123.02 or later from PTS > Rotunda tab > Diagnostic Tool Support > Download Software. Once installed, perform the BCM programmable module installation (PMI). Refer to Workshop Manual (WSM), Section 419-10 > Removal and Installation.

### APPLICABLE VEHICLES

2016 CAR: DQ CD539N EDGE  
2016 TRUCK: UB U502N EXPLORER  
2016 TRUCK: FC P552N F-150  
2016 CAR: D9 U540N MKX  
2016 CAR: ZG S550N MUSTANG  
2016 TRUCK: UB U502N EXPLORER  
2017 CAR: C7 CD391N FUSION  
2017 TRUCK: ME C489N MKC  
2017 CAR: C9 CD533N MKZ

ERROR: syntaxerror  
OFFENDING COMMAND: --nostringval--

STACK:

0  
0  
4