

SSM 50098 - 2021 F-150 - Equipped With Navigation - Illuminated TPMS Indicator And/Or Reduced Keyfob Range

Some 2021 F-150 vehicles equipped with navigation may exhibit an illuminated tire pressure monitor system (TPMS) warning indicator and/or a concern with reduced range of the keyfob. This may be due to a telematics control unit (TCU) module concern. Remove the TCU fuse and if the concern is no longer present, replace the TCU. Refer to Workshop Manual (WSM), Section 415-00. For claiming, use casual part 14F546 and the applicable labor operations of Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES
2021 TRUCK: FD P702N F150