

Special Bulletin

SP21-310

Date	Expiration	Release	Page
09.2021	09.2023	1	1(5)

First Release -

09-22-2021

INTERFERENCE BETWEEN THE WIPER ARM AND THE WIPER BLADE

Prevost vehicles


DESCRIPTION

On the vehicles affected by this bulletin, follow this procedure to correct a possible interference between the wiper arm and the wiper blade.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS	
<i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
X3-45 Commuter Model Year: 2021 - 2022	From 4RKJ33492 <u>M9737751</u> up to 4RKJ33493 <u>N9737940</u> incl.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery.	

PROCEDURE

 DANGER
<p>Park vehicle safely, apply parking brake, stop the engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.</p> <p>Lockout & Tag out (LOTO) must be performed during set-up, maintenance or repair activities. Refer to your local procedure for detailed information regarding the control of hazardous energy.</p>

1. On both wiper arm assemblies, disconnect the windshield washer fluid hoses from the nozzles.

Date	Expiration	Release	Page
09.2021	09.2023	1	2(5)

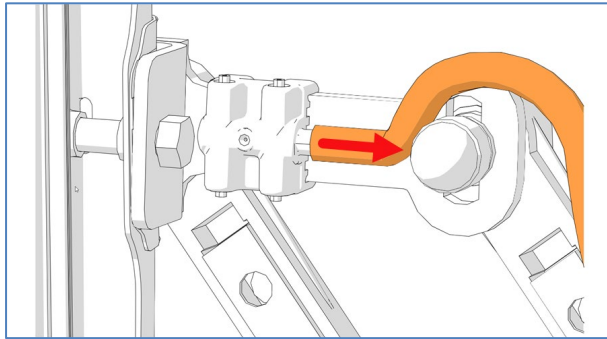


Figure 1

2. On both wiper arm assemblies, detach the hose holder. Take care not to damage the wiper arm paint.



Figure 2

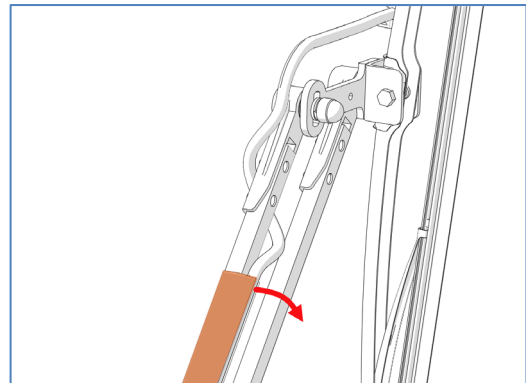


Figure 3

3. Reinstall the hose holder so that the hose groove is located as follows:
 - On the street side wiper arm assembly, the hose groove is located on the street side of the arm (Figure 4).
 - On the curb side wiper arm assembly, the hose groove is located on the curb side of the arm (Figure 4).

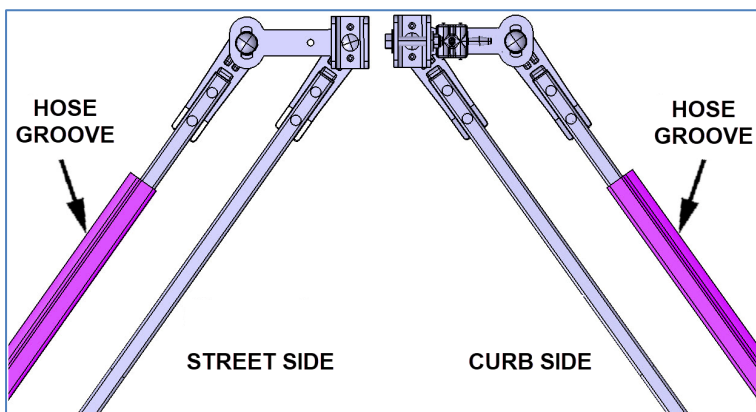


Figure 4 : AS SEEN FROM INSIDE

Date	Expiration	Release	Page
09.2021	09.2023	1	3(5)



Figure 5

4. On the street side wiper arm assembly, route the windshield washer as shown and connect to the nozzle (Figure 6).

Date	Expiration	Release	Page
09.2021	09.2023	1	4(5)



Figure 6 : STREET SIDE WIPER ARM

- 5. On the curb side wiper arm assembly, route the windshield washer as shown and connect to the nozzle (Figure 7).



Figure 7 : CURB SIDE WIPER ARM

- 6. Test the windshield washer system to make sure it does not leak.

Special Bulletin

SP21-310

Date	Expiration	Release	Page
09.2021	09.2023	1	5(5)

PARTS / WASTE DISPOSAL

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is ¼ (0.25) hour.

OTHER

VBC Bulletin	N/A
Fail Code	23.05
Defect Code	09
Syst. Cond	B
Causal Part	800216

Access all our Service Bulletins on
<http://techpub.prevestcar.com/en/>
or scan the QR-Code with your smart phone.



Prevest engages in a continuous program of testing and evaluating to provide the best possible product. Prevest, however, is not committed to, or liable for updating existing products.