

# TECHNICAL TOPICS

## POWERTRAIN



<p><b>20MY L551 Low Speed Stall</b></p> <p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> <li>– Vehicle low speed stall in high ambient temperatures</li> </ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> <li>– TCM will have P0726-21 stored</li> <li>– PCM SW suffix BAD or later and when paired with TCM suffix at a level earlier than CDP causes a mismatch in engine torque control and transmission torque converter. Results in a situation where in high ambient temperatures and high engine loads (HVAC etc) the engine could stall during an overrun downshift</li> </ul> <p><u>Status:</u></p> <ul style="list-style-type: none"> <li>– Topix WSM has been updated for TCM fault code P0726-21, requesting to ensure that the PCM and TCM are at the latest software.</li> <li>– Pathfinder has been updated starting PF345 to ensure that the TCM is now automatically updated during a PCM update if the TCM suffix is older than CDP</li> </ul> <p><b>Refer to TOPIx workshop manual Diagnostic Trouble Code Index – TCM P0726-21</b></p>	<p>2020 Evoque (L551)</p>
	



PRINTED COPIES ARE UNCONTROLLED