

Roof Opening Panel Inoperative	20 – 21MY Defender
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> <li>- A customer may report that the roof opening panel does not operate or that the sunblind lost 'One Touch' operation.</li> </ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> <li>- This may be caused by the roof opening panel motor losing calibration due to an error in the roof opening panel module software.</li> </ul> <p><u>Status:</u></p> <ul style="list-style-type: none"> <li>- The roof opening panel motor/module is not programmable via PATHFINDER.</li> <li>- A revised roof opening panel motor/module assembly has been released for service (part number LR155102).</li> <li>- SSM 75429 has been updated to advise replacing the roof opening panel motor with the revised part.</li> </ul>	