

<b>Reference</b>	SSM75394
<b>Models</b>	Defender / L663 Discovery / L462 Range Rover / L405 Range Rover Sport / L494
<b>Title</b>	INGENIUM I4 2.0L PETROL Including PHEV - Oil Level Gauge
<b>Category</b>	Engine
<b>Last modified</b>	09-Sep-2021 00:00:00
<b>Symptom</b>	401000 Oil System Concerns
<b>Attachments</b>	1SSM Attachment P337436.pdf (1SSM Attachment P337436.pdf)

**Content**

**Issue:**  
JLR has identified an issue on the Oil Level Gauge (Dipstick) where the markings are incorrect.

**Cause:**  
Marking is too low by 10-12mm. If the engine is filled to the top Oil Level Gauge mark, then it will contain less than the maximum oil level.

**Action:**  
When servicing the engine, please refer to TOPIx section 303-01: Engine - INGENIUM I4 2.0L Petrol/INGENIUM I4 2.0L Petrol - Specification and fill the specified capacity of oil. Do not use the Oil Level Gauge top mark to confirm oil fill level.

Thank you in advance for your assistance with this matter.

anBhdHRicnM7MjAyMS0wOS0xM1QxMjpwMzowOC44NTFaOzEzNi4yMjYyNDguODE7