Reference	SSM75410
Models	F-PACE / X761 I-PACE / X590
Title	I-Pace - F-Pace Clicking Noise On Full Left - Right Lock From Front Wheel Area At Low Speed.
Category	Chassis
Last modified	09-Sep-2021 00:00:00
Symptom	303000 Steering/Handling
Attachments	1Front axle hub click noise (Attachment 3).pptx (1Front axle hub click noise (Attachment 3).pptx) 1Hub click noise wheel off.mp4 (1Hub click noise wheel off.mp4) 1Road_test_hub noise.mp4 (1Road_test_hub noise.mp4)
Content	leene.

Content <u>Issue:</u>

Customers may experience a clicking/ticking noise whilst turning left or right and full lock at low speeds. Noise originating from the front wheel area.

Cause:

Brake disc to wheel hub flexing/moving during cornering load allows stick-slip movement of the disc along the wheel hub spigot.

Action:

- Confirm customer complaint from the front wheel area.(Attached media files)
- Remove road wheels.
- Clean hub spigot area (Attachment 3)
- Apply Molycote grease to hub area (MOLYKOTE® Cu-7439 Plus Paste) or equivalent anti seize compound.
- Check wheel nuts have free spinning captive washers if they do not have free spinning washers, replace affected wheel nuts.
- · Refit the road wheels.

anBhdHRlcnM7MjAyMS0wOS0xM1QxMjoxMjoxNy44NDhaOzEzNi4yMjYuNDguODE7