



GROUP	MODEL
Body	2021MY~ K5 (DL3a)
NUMBER	DATE
PS710	October 2021



TECHNICAL OPERATIONS


APPEARANCE OF WATER LEAK AND/OR CONDENSATION IN REAR CENTER COMBINATION LAMP

SUBJECT:

This Pitstop provides clarification on what appears to be a water leak and/or condensation in the rear center combination lamp assembly on some 2021MY~ K5 (DL3a) vehicles. The top area of the rear center combination lamp assembly can have the appearance of condensation behind the lens. This is a normal condition for water and/or condensation to be present above the sonic weld line. As the weld forms a lip along the top of the rear combination lamp, water may enter the back side of the lens but does not actually enter the inside of the lamp housing. Replacement of the rear center combination lamp is not necessary.

In case of customer concerns, water leak and/or condensation may be cleared from the area by:

1. Giving it some time to dry (about one hour outside on a dry, warm day)
2. Lightly blowing shop air between the trunk lid and the lamp housing.

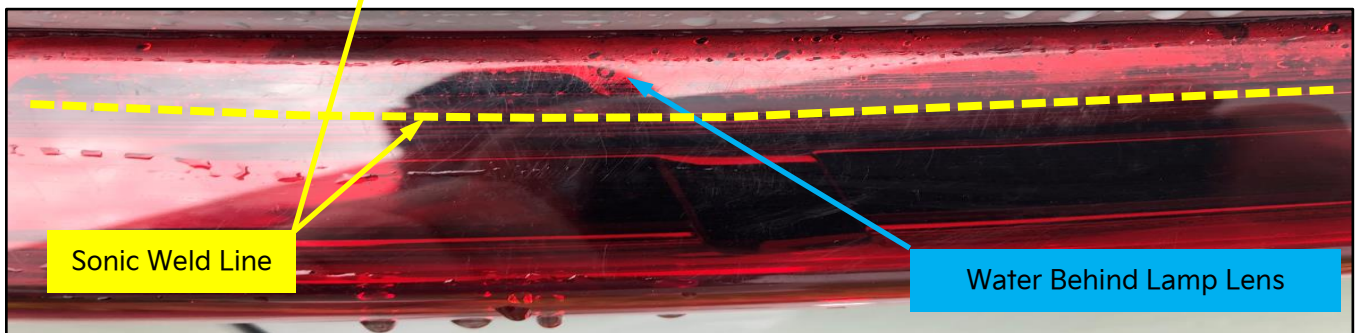

NOTICE

Replacement of the rear center combination lamp is not required for the condition stated above. Warranty claims submitted for replacement of the rear center combination lamp assembly will be subject to chargeback.