



Technical Journal

TITLE:

Unrestricted Speed Setting Does Not SaveREF NO:
TJ 36012.1.1ISSUING DEPARTMENT:
Technical ServiceCAR MARKET:
United States and CanadaPARTNER:
3 US 7510 Volvo Car USAISSUE DATE:
2021-07-19STATUS DATE:
2021-07-27FUNC GROUP:
3610FUNC DESC:
Programming and diagnosis**Page 1 of 2****“Right first time in Time”**

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

Driver may find that vehicle speed is restricted after speed restriction is removed during Pre-Delivery Service (PDS).

CSC Customer Symptom Codes

Code	Description
1Z	Service/repair/Software update failed
1Q	Driving/Poor performance/lacks power/At take off

DTC Diagnostic Trouble Codes**Vehicle Type**

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
536	ED	E400V6					2021-9999		-	0-0

**SERVICE:**

After the Unrestricted Speed setting is set with VIDA, the Engine Control Module (ECM) must go to sleep before the setting is saved permanently.

Once the setting is changed, if a software download is performed or if the vehicle is set to Programming mode and reset before the ECM has had a chance to go to sleep, the setting will revert back to the original setting.

To avoid this, after setting Normal mode and Unrestricted Speed during PDS, close and lock the vehicle for 2-5 minutes before proceeding to download a *PDS Upgrade* or other software.

VEHICLE REPORT:

Not required.