

SIB 61 08 21

2021-07-21

CIGARETTE LIGHTER IS DIFFICULT TO PULL OUT

| E-Series | Model Description | Production Date | Affected Option Code |
|----------|----------------------|---|----------------------|
| G20 | 3 Series Sedan | Start of production to June 1 st , 2021 | 441 Smoker's Package |
| G22 | 4 Series Coupe | | |
| G23 | 4 Series Convertible | | |
| G80 | M3 Sedan | | |
| G82 | M4 Coupe | | |


SITUATION

The cigarette lighter is difficult or impossible to pull it out.

CAUSE

Ring light in the center console socket is deformed.

PROCEDURE

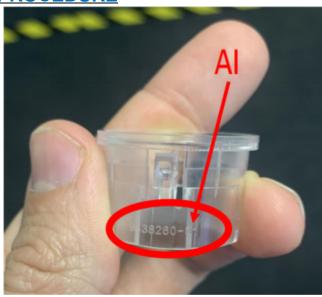

Remove the socket and replace the clamping ring with part number

61 34 9438260 Clamping ring for 12 V power socket.

Note: A clamping ring with the revision index (AI) -02 or higher must be installed.

Alternatively, a ring light with part number 61 42 7947770 Ring light without LED can also be used on vehicles without Ambient Lighting.

PARTS INFORMATION

Obtain and confirm the part numbers for your specific vehicle by entering the chassis number in either ETK or AIR which takes into account specific equipment and/or options.

| Part Number | Description | Quantity |
|---------------|--------------------------------------|----------|
| 61 34 9438260 | Clamping ring for 12 V power socket. | 1 |
| Or | | |
| 61 34 7947770 | Ring light without LED | 1 |

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

| Defect Code: 6 | 6134013700 | 12 V socket outlet loose |
|----------------|------------|--------------------------|
|----------------|------------|--------------------------|

Refer to AIR for the corresponding flat rate unit (FRU) allowance.

| Operation | Description | Labor Allowance |
|-----------|---|-----------------|
| 51 16 151 | Replace (12 V socket clamping ring) front storage compartment (Main work) | Refer to AIR |
| Or: | | |
| 51 16 651 | Replace (12 V socket clamping ring) front storage compartment (Plus work) | Refer to AIR |

If you are using a Main labor code for another repair, use the Plus code labor operation 51 16 651 instead of 51 16 151.

Based on which one applies to your center, please refer to **SI B01 01 20 or B01 07 20** for claiming your diagnosis work time, job/repair work time (WT), RO/Claim WT and/or repair explanation procedures, unless otherwise required by State law.

QUESTIONS REGARDING THIS BULLETIN

| Technical inquiries | Submit feedback at the top of this bulletin |
|---------------------|---|
| Warranty inquiries | Please contact the Warranty department by either using the Live Chat that's available in the Warranty Documentation Portal or through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections |
| Parts inquiries | Submit an IDS ticket to the Parts Department |