

Technical Journal

TITLE:

Unrestricted Speed Setting Does Not Save

REF NO: TJ 36013.1.1	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7515		ISSUE DATE: 2021-07-20	STATUS DATE: 2021-07-26
FUNC GROUP: 3610	FUNC DESC: Programming and diagnosis	Page 1 of 1	

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

Driver may find that vehicle speed is restricted after speed restriction is removed during Pre-Delivery Service (PDS).

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
534	ED	E400V6					2021-9999		-	0-0

SERVICE:

After the Unrestricted Speed setting is set with VIDA, the Engine Control Module (ECM) must go to sleep before the setting is saved permanently.

Once the setting is changed, if a software download is performed or if the vehicle is set to Programming mode and reset before the ECM has had a chance to go to sleep, the setting will revert back to the original setting.

To avoid this, after setting Normal mode and Unrestricted Speed during PDS, close and lock the vehicle for 2-5 minutes before proceeding to download a PDS Upgrade or other software.

LABOR TIME:

Labor time subject to change without notice.

VEHICLE REPORT:

None required.