 


# Front Brake Squeal/Squeak Noise

Service

Category Brake

Section Brake (front) Market USA



## **Applicability**

| YEAR(S)     | MODEL(S) | ADDITIONAL INFORMATION |
|-------------|----------|------------------------|
| 2020 - 2021 | GX460    |                        |

# Introduction

Some 2020 – 2021 model year GX 460 vehicles may exhibit a squeal/squeak noise from the front brakes with light to moderate braking. Follow the Repair Procedure in this bulletin to address this condition.

# **Production Change Information**

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

| MODEL  | PLANT  | PRODUCTION CHANGE EFFECTIVE VIN |  |
|--------|--------|---------------------------------|--|
| GX 460 | Tohoro | JTJAM7BX#M5303146               |  |
|        | Tahara | JTJGM7BX#N5303047               |  |

L-SB-0032-21 September 27, 2021 Page 2 of 3

# (LEXUS

# Front Brake Squeal/Squeak Noise

## **Warranty Information**

| OP CODE | DESCRIPTION            | TIME | OFP         | T1 | T2 |
|---------|------------------------|------|-------------|----|----|
| 473301  | R & R Front Brake Pads | 0.8  | 04465-35330 | 36 | 50 |

#### **APPLICABLE WARRANTY**

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

#### **Parts Information**

| PART NUMBER | PART NAME               | QTY |
|-------------|-------------------------|-----|
| 04465-35330 | Pad Kit, Disc Brake, FR | 1   |

#### NOTE

Confirm the lot number on the pad kit packaging is AFTER 07/23.

For example: G23 – July 23<sup>rd</sup> (G = July, 23 = 23<sup>rd</sup> day of the month).

Figure 1. Pad Kit Packaging



### **Repair Procedure**

1. Confirm the condition exists.

Does the vehicle exhibit a squeal/squeak noise from the front brakes with light to moderate braking?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.



Page 3 of 3

# Front Brake Squeal/Squeak Noise

### **Repair Procedure (continued)**

- 2. Replace the front brake pads.
  - A. Remove the front brake pads.

Refer to TIS, applicable model and model year Repair Manual:

- 2020 2021 GX 460:
  Brake Brake (Front) "Brake (Front): Front Brake: <u>Removal</u>"
- B. Install the NEW front brake pads.

Refer to TIS, applicable model and model year Repair Manual:

2020 – 2021 GX 460:
 Brake – Brake (Front) – "Brake (Front): Front Brake: <u>Installation</u>"

3. Test-drive the vehicle to confirm proper brake pad installation.