

## **SSM 50210 - 2021 Bronco - Loss Of Power When Driving With Various Illuminated Warning Indicators Displayed In The IPC - Built On Or Before 14-Sep-2021**

Some 2021 Bronco vehicles built on or before 14-Sep-2021 may experience a loss of power when driving with various illuminated warning indicators displayed in the instrument panel cluster (IPC). This may be due to an improper seating of the wiring harness push pins to the driveshaft loop which can cause an interference condition between the rear driveshaft and the 14405 harness near the C2370/C350 connector. If suspected, inspect the harness and connector for damage and repair as necessary. Once inspected and/or repaired fully, seat the harness push pins to the driveshaft loop.

APPLICABLE VEHICLES  
2021 TRUCK: G1 U725N BRONCO