## **SSM 50229 -** 2021 F-150 - 400W AC Power Outlets Inoperative With Diagnostic Trouble Code (DTC) B1330:9A Stored In The Body Control Module (BCM)

Some 2021 F-150 vehicles equipped with a 400W alternating current (AC) power outlet system may experience the AC power outlet system being inoperative and DTC B1330:9A stored in the BCM. This may be due to a connection and/or outlet issue at any of the 3 AC power outlets. If this concern is present, closely inspect C4628 at the pickup bed AC outlet for possible connection and/or contamination issues and repair as necessary. If there are no connection or contamination issues present at C4628, or a repair has been made AC power outlet system, you must download and run the Reset the Battery Monitoring Sensor Learned Values app (routine 203A) in the FDRS to relearn the direct current/alternating current converter module A (DCACA) outlet configuration and retest. If the B1330:9A persists, continue with normal diagnostics in the Workshop Manual, Section 414-05.

APPLICABLE VEHICLES 2021 TRUCK: FD P702N F150