


## TECHNICAL TOPICS

### BODY/CHASSIS



Roof Opening Panel Inoperative	20 – 21MY Defender
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"><li>- A customer may report that the roof opening panel does not operate or that the sunblind lost 'One Touch' operation.</li></ul> <p><u>Technical Description:</u></p> <ul style="list-style-type: none"><li>- This may be caused by the roof opening panel motor losing calibration due to an error in the roof opening panel module software.</li></ul> <p><u>Status:</u></p> <ul style="list-style-type: none"><li>- The roof opening panel motor/module is not programmable via PATHFINDER.</li><li>- A revised roof opening panel motor/module assembly has been released for service (part number LR155102).</li><li>- SSM 75429 has been updated to advised replacing the roof opening panel motor with the revised part.</li></ul>	 <p>A 3D perspective view of a grey Land Rover Defender. The roof opening panel is highlighted in yellow. Two black components, likely the motor and module, are shown mounted on the roof panel. A small black square icon with a white 'e' is in the top left corner of the image frame. The number 'E250841' is visible in the bottom left corner of the image frame.</p>

