

 **HYUNDAI**
Technical Service Bulletin

GROUP	NUMBER
Body Electrical	21-BE-014H
DATE	MODEL(S)
October, 2021	Accent (HC)

SUBJECT: ACCENT (HC) TRANSPORTATION SHIPPING FUSE INSPECTION GUIDELINES

Description: If a vehicle arrives at the dealership with the symptoms below, follow the procedures outlined in this bulletin to ensure that the shipping fuse is completely seated in the junction box.


- TPMS Lamp ON
- Trunk Open Warning Lamp ON while trunk is closed
- Master Warning Mode Lamp ON
- Interior lights inoperative
- Audio system inoperative

Applicable Vehicles: All 2018-2022MY Accent (HC) vehicles.


Warranty Information:
Normal Warranty Applies.

Service Procedure:

1. Locate the lower driver side junction box and remove the cover.
2. In the lower driver side junction box, verify that the Audio Fuse (A) and Room Fuse (B) are not blown. If fuses are blown, replace with fuses of equivalent amperage ratings.

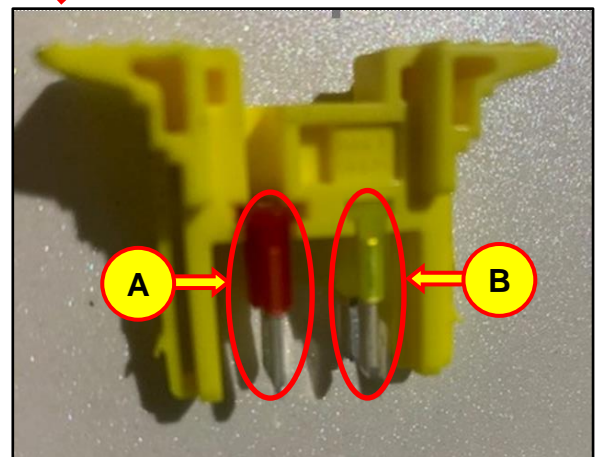

3. Verify that the yellow transportation fuse (C) is in the ON position by firmly pressing the yellow transportation fuse tab into place.

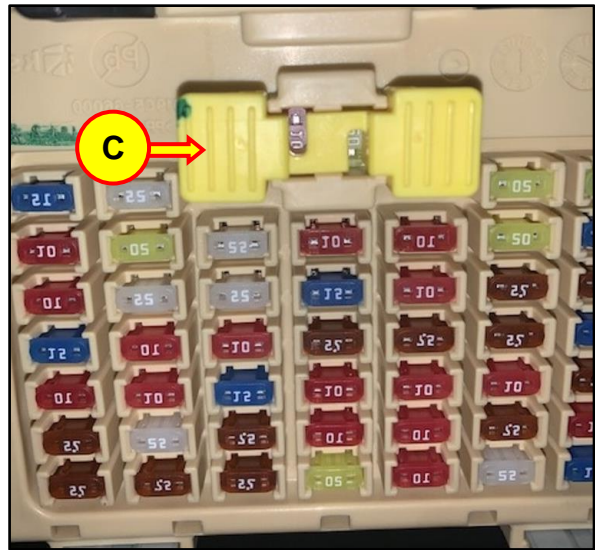

4. Verify that the electrical issues have been resolved.
5. The service procedure is now complete.