

# SS 3076-FTL2021 P4 Main Mirror Arm Covers Loose - Falling Off

## **Applicable Vehicles**

All New Cascadia models built before March 2nd, 2020.

## **Symptoms**

Lower arm covers LH/RH loose or falling off.

## **Issue**

Lower arm covers designs have clips that hold the cover on but over time the clips can fail and allow the covers to become loose or fall off.

## **Solution**

Add a push pin or screw to secure the Arm Covers in Place as shown in the following figure:

# P4 Mirror - Arm Cover Field Service Fix

- RH mirror shown
- Dimensions are approximate
- Drill  $\frac{1}{8}$ " diameter hole through cover and into bezel to apply push connector 23-12251-001.
- As alternate drill  $\frac{1}{8}$ " diameter hole and use #8 screw WWS 4014-3417 screw instead of 23-12251-001.
- See next slide for process details



Figure 1: Installation of push pin - screw.

Vehicles built on March 2nd 2020 and after, have a new improved Mirror Lower Arm Cover Design.

Labels :

New Cascadia

Add tags



3 Kudos

Comment