

01IND2021-11-04
Product Line: IND
Post Date: 2021-11-04

MSD Thread Subject
Indian Challenger U2612 code

MSD Post Content

We have seen a few Indian Challenger models with problems ranging from a no start condition, to not being able to complete a stage reflash or a fuel cap not respnding to pushing the open button. or random data missing from a service report. We have found a hand full of bikes with such concerns that were corrected by replacing the key fob battery. The two cases that I resolved both showed the u2612 code as current in the service reports. One of them also displayed a current p1634 code which indicates a low key fob battery, yet the fob worked to start the bike. We really don't know much more about this phenomenon currently; I just wanted to make you all aware of something we recently have discovered. I suspect this may affect any bike that employs a wireless control module, but that is pure speculation on my part at this time. Hope this helps -Bob