

SSM 50261 - 2021-2022 F-Super Duty - 10R140 Automatic Transmission – Harsh Engagement/HarshShift/Delayed Shift With Or Without Diagnostic Trouble Codes (DTC)

Some 2021-2022 F-Super Duty vehicles may exhibit harsh or delayed engagement/shift concerns. Most concerns may be addressed with the PCM/TCM Transmission Accelerated Main Control Break In Routine. Refer to Workshop Manual (WSM), Section 307-01, DTC Chart and/or Diagnosis By Symptom to identify the clutch(s) to be cycled. This routine cycles the shift solenoids and clutch control valves to remove contamination that may be sticking the valves and must be performed along with an adaptive learning drive cycle before attempting internal service. Although this routine was originally developed for low mileage vehicles, it has proven effective for resolving many shift and engagement symptoms across the life of the vehicle. For claiming, use causal part 7A100 and applicable labor operations in Section 7 of the Service Labor Time Standards Manual.

APPLICABLE VEHICLES
2021 - 2022 TRUCK: FE P558N SUPER DUTY