



Diagnostic Trouble Code (DTC) P0201 To P0206 FMI 13 - OBD2015 HDE 11 (Model Year 2016 Truck)



> Internal Content

Brand	Engine SN	Chassis #
Mack	575954	CXU613 - 75556
Volvo	575976	N 936453


DTC P0201 FMI 13 to P0206 FMI 13 (Injectors 1 through 6 Open Circuit)

Other possible short circuit faults can log in the following components.

- Crank Speed sensor
- Cam Speed sensor
- Boost pressure sensor
- EGR temp sensor
- EGR differential pressure sensor
- EGR valve
- Pre-Heater sensor wire
- Recommended Actions – Inspect the engine harness
- Vehicle effect – MIL lamp and engine miss

Recommended Actions:

The engine harness in the air compressor area may not be supported correctly and may have made contact with the air compressor. When these faults are logging, look in this area first. Do not check under the valve cover until this area has been inspected. A service publication will be released to address this issue.

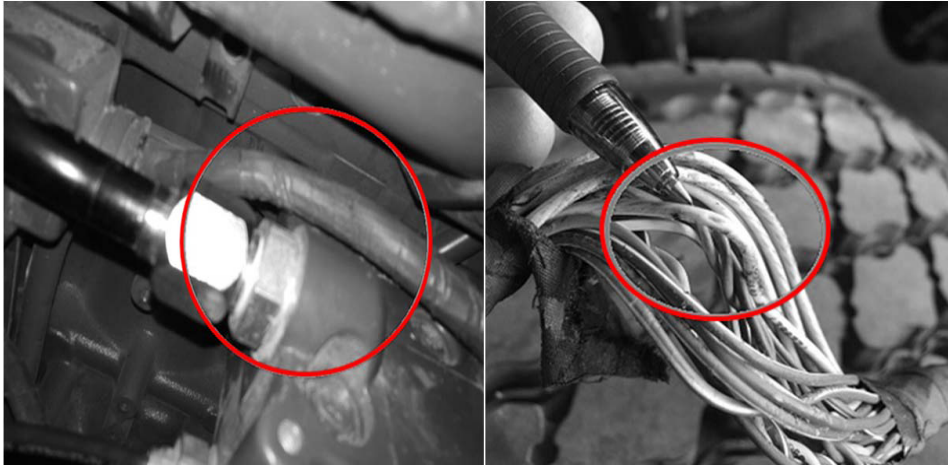

Tags

[p020113](#) [p020213](#) [p020313](#) [p020413](#)
[p020513](#) [p020613](#) [k27240982](#) [p0201-13](#)
[p0202-13](#) [p0203-13](#) [p0204-13](#) [p0205-13](#)
[p0206-13](#)

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article