

Reference	SSM75621
Models	Defender / L663 Discovery / L462 Discovery Sport / L550 New Range Rover / L460 New Range Rover Evoque / L551 Range Rover Velar / L560
Title	Fuel Flap locking not working. BCM DTC B1C91 logged.
Category	Electrical
Last modified	26-Nov-2021 00:00:00
Symptom	203000 Basic Electrical

Content

Affected models
L460 21MY
L461 22MY
L462 22MY
L550 22MY
L551 22MY
L560 22MY
L663 21 & 22MY

Issue:

Customers may complain of fuel flap remains unlocked when vehicle locked.
Retailer investigate and determine DTC B1C91 present in BCM

Cause:

New BCM design intent introduced due to world wide chip shortage.

Action:

If the DTC is logged in the BCM request GDS support to ensure the CCF parameter 0x5167 LockFuelFillFlap is set to 0x01 (not fitted) instead of 0x02 (fitted)

anBhdHRicnM7MjAyMS0xMj0wMjQxMzoyMj00MS44NDNaOzE2NS4yMjUuNTYuMj1wOw==