



## STAR ONLINE PUBLICATION



**Case Number:** S2123000074

**Release Date:** November 2021

**Symptom/Vehicle Issue:** Front Wheel Well Splash Liner Contacting Tire

**Customer Complaint/Technician Observation:** Rub marks on the front wheel well splash shields

**Discussion:** 6.4L Wrangler (J9 body designation) uses a unique part number splash shield for the front wheel wells. The larger tires can cause negative pressure in the wheelhouse which can cause the splash shields to be “sucked” into the tire. If a vehicle exhibits contact between the liner and tire first make sure the correct splash liners are installed. A part ID sticker is located at the 12o'clock position on the liner.

The correct wheel liners for J9 (6.4L equipped Wrangler) are-  
05043154AB(or later)- Front Right side wheel liner  
05043155AB(or later)- Front Left side wheel liner

If the correct liners are installed verify all fasteners are installed. Replace any missing or damaged fasteners.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**