

Published date: 11/22/2021

Preliminary Information

PIT5774D Overhead Roof Console Inoperative / Service Safety Restraints Message / Sunroof Inoperative / Dome Lights Inoperative / DTCs B1A7A and U1121

Models

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	Halisillissions.
Chevrolet	Suburban	2021	All	All	All	All
Chevrolet	Tahoe	2021	All	All	All	All
GMC	Yukon Models	2021	All	All	All	All

Involved Region or Country	North America
	Some customers may comment on the following complaints:
	- Service Safety Restraints System Message
	- Sunroof Inoperative
	- Sunshade Lights Inoperative
Condition	- Dome Lights Inoperative
	- Power Liftgate Inoperative when using switch in overhead console
	When the vehicle is checked for DTC's there will be a current U1121 set in the BCM
	and B1A7A set in the Restraints Module.
Cause	The cause of these concerns could be the Roof Console A103.

Correction:

Engineering has released updated Roof Consoles to correct these concerns. Inspect the A103 Roof Console connector for being properly installed/seated, as well as, for any terminal issues. If the root cause is found to be a connector or terminal issue, then repair as necessary. If none are found, then replace the A103 Roof Console with an updated part number listed in the parts section below.

Parts Information

Part Number	Description	QTY
85164174	Roof Console - Black	1
85164173	Roof Console - Dk Atmosphere	1
85164172	Roof Console - Gideon	1

Note: The most common part numbers for the updated roof consoles are listed above, but if they do not apply to your specific vehicle then please contact Partech with your VIN to obtain the latest roof console part number.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage

information.

Labor Operation	Description	Time
1035580	Roof Console Replacement	Use published time

Version History

Version	5
	09/14/2020 - Created on.
	07/26/2021 - Updated to Cause, Correction, Parts, and Warranty sections
Modified	08/16/2021 - Updated to correct part numbers.
	08/26/2021 - Update to the parts sections
	11/22/2021 - Update to the Correction section.

















GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.