

2022 Rekon

Customer complaint: Propane is leaking around regulator. Tech notes: Internal failure. smelled LP so I sprayed with soapy water to determine where it was coming from. saw bubbles forming on sides where press fitted. loosen the 2 fittings on top and bottom remove bracket from wall to access screws holding regulator to bracket. fasten new regulator to mounting bracket and attach to wall with butel tape on back. reapply Teflon tape to male fillings and tighten. then preform a LP drop test to ensure no leaks. labor 1.50
45 minutes approved maximum. The regulator easily accessible and there are only 2 bolts that holds it in place.