

**SIB 32 01 13**

2021-09-03

SERVICE ACTION: Throttle Twistgrip - Bulletin 32 001 13 (029)

This Service Information Bulletin replaces SI 32 001 13 (029) **dated November 2013**.

The contents of this bulletin have not changed; bulletin numbering was updated.

MODEL

This document applies to the following Motorrad AG models: 0A11

This document applies to the following Motorrad model descriptions: R 1200 GS

This document applies to the following Motorrad series: K50

SITUATION

This document is applies to the following categories: Steering and Wheel Alignment

Supporting Materials

[picture_as_pdf 32_001_13_029_Throttle_twistgrip.pdf](#)

Retail Operator General Manager	Sales New Motorcycles	Sales Pre-Owned Motorcycles	Business Manager (F&I)	Service	Parts & Accessories	Administration
Date: November 2013 Bulletin # 32 001 13 (029)		Source: SI 26/2013 Name: Shawn McLean Title: Service & Technical Manager Phone: 201-307-4131				



BMW Motorrad USA

Service Information Bulletin

****Technical Campaign****

Subject: Throttle twistgrip

Model: R 1200 GS (K50, 0A11 / 0A11) with OE 0538, "Cruise control"

Details: BMW Motorrad has ascertained that in rare cases the throttle twistgrip sends an implausible signal to the engine management system when the throttle valve is closed. The engine control unit interprets this as a fault and activates an emergency-operation program ('General' warning light shows yellow, engine symbol appears on the display). Switching the ignition off and then on again restores the engine to full working order.

Vehicles affected: In order to determine if a specific vehicle is affected by this Technical Campaign, it will be necessary to verify all vehicle VINs through a DCS Vehicle History Check. Based on the response of the system, either proceed with the repair or take no further action. Please note, affected VINs may not appear until 24-72 hours after the release of this bulletin.

Production Solution: As of February 27, 2013, throttle twistgrips with optimized characteristic have been used in series production.

Aftersales Solution: On the motorcycles in question, the throttle twistgrip will have to be replaced and the replacement taught in with the BMW Motorrad diagnostic system (either before the new motorcycles are handed over to customers or when the motorcycles are next brought in to the workshop).
See the description of work item "32 72 001 Replacing throttle twistgrip" on the current RSD (Repair and Service Data BMW Motorrad) DVD.

Warranty Information: The repair described in this bulletin is covered under warranty regardless of time or mileage.

Warranty:

Defect code:	00 32 10 00 00	Replacing throttle twistgrip
Labor code:	*32 72 001	Replacing throttle twistgrip, See RSD for FRU amount
Part number:	61 31 8 522 472	Throttle twistgrip

*Main Work 32 72 001 - the FRU amount this main labor operation credits includes all repair procedures to complete the task with allowance for necessary ancillary tasks (e.g., visual inspection, lubrication, cleaning parts etc.) and administrative tasks. Only one main labor operation can be claimed per repair visit. All other labor operations for any other line(s) must be claimed using plus code labor operations.

Please refer to the Warranty Policy and Procedures Manual regarding add-ons, proper support, documentation, claims submission and archiving requirements as applicable.

Contact: Service and Technical Manager