

**SIB 61 01 02**

2021-09-02

SERVICE ACTION: Alternator cable chafed through - Bulletin 61 001 02 (032)

This Service Information Bulletin replaces SI 61 001 02 (032) **dated November 2002**.

The contents of this bulletin have not changed; bulletin numbering was updated.

MODEL

This document applies to the following Motorrad AG models: 0429,0419,0447,0455

This document applies to the following Motorrad model descriptions: R 100 RS,R 1150 RT

This document applies to the following Motorrad series: R22,247

SITUATION

This document is applies to the following categories: General Electrical Systems

Supporting Materials

[picture_as_pdf 6100102 Alternator Cable Chafed.pdf](#)

Service Bulletin

Page 1 of 1

Date: November 2002

Bulletin No: 61 001 02 (032)

BMW Motorcycles

Subject: **Technical Action: Alternator cable chafed through: R 1150 R, RT, RS and R 1100 S models fitted with Integral ABS.**

Subject: If the connector is badly positioned, the blue cable from the alternator to the charge indicator light can show signs of chafing. In extreme cases a short circuit may result.

Details: Engine vibrations can cause the cable to chafe through where it contacts the bracket of the Integral ABS control unit.

Production Measures: Beginning with the VINs listed below, an edge protector has been fitted to the bracket of the IABS control unit during production.

Model	First VIN corrected in Production
R 1100 S	ZB 52311
R 1150 R	ZF 45882
R 1150 RT	ZE 87186
R 1150 RS	ZG 70003

Service Measures: Check each example of the above models that enter your workshop for the following criteria:

- 1) A VIN earlier than the VIN noted above.
- 2) Equipped with IABS

On the VIN meeting this criteria, fit the required edge protector, part number 34 32 2 331 053, to the edge of the bracket holding the IABS control unit.

For warranty reimbursement, enter a regular warranty claim using the special claim keys noted in the chart below.

Model	Last VIN affected	Defect Code	Flat Rate Code	Flat Rate Description	FRU
R 1100 S	ZB 52310	00 61 16 00 00	00 60 584	Check cable / install edge protection.	13
R 1150 R	ZF 45881	00 61 16 00 00	00 60 584	Check cable / install edge protection.	6
R 1150 RT	ZE 87185	00 61 16 00 00	00 60 584	Check cable / install edge protection.	12
R 1150 RS	ZG 70002	00 61 16 00 00	00 60 584	Check cable / install edge protection.	8



Robert Goodheart
Manager Aftersales
BMW Motorcycles



Pat Raymond
Service and Technical Manager
(201) 307 4261
pat.raymond@bmwna.com

