

Technical Journal

TITLE:

Information in DIM “system check, please wait” and no start

REF NO: TJ 36073.1.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2021-10-22	STATUS DATE: 2021-10-28
FUNC GROUP: 3113	FUNC DESC: Battery, high voltage	Page 1 of 3	

“Right first time in Time”

DESCRIPTION:

If the customer experienced vehicle no start and DTC BECM-P0ABF96 is set at the same time as the symptom appeared, please follow instruction under “Service”.

CSC Customer Symptom Codes

Code	Description
BE	Starting/Engine does not start/Engine does not turn/Unsure when/at all times

DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
BECM	P0ABF96	Permanent

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
536	ED	E400V6					2021 -2022		-	202035 -202140

Technical Journal 36073.1.0

SERVICE:

Do not replace any parts.

New Battery Energy Control Module (BECM) software released 2021w40("1.7") includes improved robustness in the communication between the BECM and the Current Measurement Sensor (CMS) which will prevent the symptom.

Perform an upgrade of the software according to TJ 31543.

*Warranty claim info:

To get warranty claim accepted for a job described in this TJ, please use following data:

VST OP number: 36004-2

VST Operation Number

VST Operation Number	Description
36004-2	Software control module downloading

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support needed", use function group 3113.