

SERVICE ACTION

Reference number:	SA-30-1573	Issued: 06 December, 2021
Subject:	Check and Install New Door Trim Clips	
Model(s):	DBX	
VIN Range:	Refer to the separately published list of affected Vehicle Identification Numbers (VINs)	
Applicable to:	All Dealers	
Distribute to:	After Sales Manager Executive Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Reason For this Service Action

Aston Martin has found that some DBX vehicles may have incorrect door trim clips installed. This can cause the door trim panels to become loose.

Do the workshop procedures that follow to check, and if necessary, install new door trim clips.

Part A

Workshop Procedure

1. Open and close the front and rear doors with the handle from inside the vehicle.
 - Listen and feel for any loose areas of the door trim panel.
2. Open each door and inspect for any gaps between the door trim panel and the door panel.
3. If the door trim panel is not loose or does not show a gap of more than 1.5mm between the door trim panel and the door panel, no further work is necessary.
4. If the door trim panel is loose or shows a gap of more than 1.5mm between the door trim panel and the door panel, do the applicable procedure in Part B.

Part B

Workshop Procedure

1. Remove the trim panel for the right side front door (refer to Workshop Manual Procedure 30.06.AL).
2. Remove the trim panel for the left side front door (refer to Workshop Manual Procedure 30.06.AP).
3. Remove the trim panel for the right side rear door (refer to Workshop Manual Procedure 30.06.BL).
4. Remove the trim panel for the left side rear door (refer to Workshop Manual Procedure 30.06.BD).

Warranty Data**Procedure and Labour Time****Tier A**

Description	Labour Time
Inspect 4 doors, no new clips necessary	0.10

Tier B

Description	Labour Time
Inspect 4 doors, install new clips to 1 door	0.7

Tier C

Description	Labour Time
Inspect 4 doors, install new clips to 2 doors	1.3

Tier D

Description	Labour Time
Inspect 4 doors, install new clips to 3 doors	1.9

Tier E

Description	Labour Time
Inspect 4 doors, install new clips to 4 doors	2.5

Part Data

Description	Part Number	Quantity
Trim Clip	KY63-2685-AB	As Necessary

Please Note:

When you have completed this Service Action, make sure that you make an entry in Section A of the Vehicle Owner's Guide to show that the procedure is completed.

Yours faithfully



John Cranfield

Senior Manager - Client Technical Services

If you have any questions related to this document, please refer to the 'Contact Us' link on this webpage, or contact your local Dealer or After Sales Manager.

The English version of this document is written in Simplified Technical English to ASD-STE100™.