



SIB 46 05 21

SERVICE ACTION: OPTIONAL ACCESSORY FOOTRESTS

2021-11-03

This Service Information Bulletin replaces SIB 46 05 21 **dated October 2021**.

What's new:

- Warranty Information amended.
- Image added.

MODEL

Models	Model Description	Production Date
K50	R 1200/1250 GS	Only if equipped with certain accessory foot pegs
K51	R 1200/1250 GS Adventure	Only if equipped with certain accessory foot pegs
K80	F 750 GS	Only if equipped with certain accessory foot pegs
K81	F 850 GS	Only if equipped with certain accessory foot pegs
K82	F 850 GS Adventure	Only if equipped with certain accessory foot pegs

The affected vehicles have been marked with the Special Information campaign number **INFO772590** in AIR.

Since the affected parts were not installed at the factory, it is **not possible** to determine if a specific vehicle is affected by this campaign by verifying the VIN in AIR (Aftersales Information Research).

AIR will display this bulletin in the Special Information section for all motorcycles that had the affected parts available as an accessory, and the presence of this bulletin in AIR does not imply that affected accessories were installed on a particular vehicle; **it is therefore necessary to visually assess the motorcycle and confirm whether the affected accessory parts were installed.**

Please note, open campaigns or vehicle stops may not appear in DCS Warranty Vehicle Inquiry or sales systems until 24-72 hours after they are announced, therefore AIR is always the recommended method for determining open campaigns and vehicle stops.

SITUATION

Stress corrosion cracks may occur on the studs of certain milled footrests from the BMW Motorrad special accessories catalog for the GS models. The following part numbers are affected:

- **77 25 2 452 958** Footrest adjustable, left, black solid
- **77 25 2 452 960** Footrest adjustable, right, black solid
- **77 25 2 465 256** Set of footrests adjustable, black solid



The original BMW Motorrad accessory footrests with the part numbers listed above are no longer offered and should no longer be sold. The footrests must be removed from the sales floor.

PROCEDURE

This Service Action only applies to certain Accessory Milled Footrests, part numbers are listed above. Check if the bike has these specific accessories; if they do not, no action is required. Customer vehicles coming in must be actively inspected for affected footrests that must be exchanged.

In the affected vehicles, the installed accessory footrests adjustable black solid must be exchanged with accessory footrests Shadow (Option 719).

Refer to the model-specific repair and installation instructions in AIR, e.g., "77 25 015 – Installing rider footrests adjustable"

PARTS INFORMATION

Part numbers R 1200/1250 GS/Adventure

46 71 9 829 537	Shadow footrest, left
46 71 9 829 532	Shadow footrest, right
46 71 9 829 535	Shadow footrest hinge, left

46 71 9 829 530	Shadow footrest hinge, right
46 71 8 526 107	Torsion spring (order 2×)

Part numbers F 850 GS Adventure

46 71 9 829 537	Shadow footrest, left
46 71 9 829 532	Shadow footrest, right
46 71 9 829 535	Shadow footrest hinge, left
46 71 9 829 530	Shadow footrest hinge, right
46 71 8 526 107	Torsion spring (order 2×)

Part numbers F 750 GS, F 850 GS

46 71 9 829 537	Shadow footrest, left
46 71 9 829 532	Shadow footrest, right
46 71 9 829 535	Shadow footrest hinge, left
46 71 9 829 530	Shadow footrest hinge, right
46 71 8 526 107	Torsion spring (order 2×)

If Option 719 replacement part is not compatible for a specific VIN/Model, contact TSARA for additional replacement options/information.

WARRANTY INFORMATION

When submitting a warranty claim, please select Type 2 for parts warranty.

Defect code

77 25 90 00 00	Replacing optional accessories footrests adjustable
----------------	---

Labor Operation

00 60 393	Replacing rider footrests	3 FRU
+00 60 893	Replacing rider footrests	2 FRU
46 52 510	Removing and installing the rear-wheel stand special tool (motorcycles without center stand)	1 FRU

FRUs includes all repair procedures to complete the task with allowance for necessary ancillary tasks (e.g., visual inspection, lubrication, cleaning parts etc.) and administrative tasks.

Labor operation code 00 60 393 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation instead.

QUESTIONS REGARDING THIS BULLETIN

Technical inquiries	Contact the BMW Technical Support Group via TSARA
Warranty inquiries	Submit an IDS ticket to the Warranty Department
Parts inquiries	Submit an IDS ticket to the Motorrad Parts Department

Supporting Materials

[picture_as_pdf 46 05 21 SERVICE ACTION OPTIONAL ACCESSORY FOOTRESTS.pdf](#)

Service Information Bulletin

Frame and mounting parts

November 3, 2021

46 05 21

SERVICE ACTION: OPTIONAL ACCESSORY FOOTRESTS



This Service Information Bulletin replaces SIB 46 05 21 dated October 2021.

What's new:

- Warranty Information amended.
- Image added.

MODEL

Models	Model Description	Production Date
K50	R 1200/1250 GS	Only if equipped with certain accessory foot pegs
K51	R 1200/1250 GS Adventure	Only if equipped with certain accessory foot pegs
K80	F 750 GS	Only if equipped with certain accessory foot pegs
K81	F 850 GS	Only if equipped with certain accessory foot pegs
K82	F 850 GS Adventure	Only if equipped with certain accessory foot pegs

The affected vehicles have been marked with the Special Information campaign number **INFO772590** in AIR.

Since the affected parts were not installed at the factory, it is **not possible** to determine if a specific vehicle is affected by this campaign by verifying the VIN in AIR (Aftersales Information Research).

AIR will display this bulletin in the Special Information section for all motorcycles that had the affected parts available as an accessory, and the presence of this bulletin in AIR does not imply that affected accessories were installed on a particular vehicle; **it is therefore necessary to visually assess the motorcycle and confirm whether the affected accessory parts were installed.**

Please note, open campaigns or vehicle stops may not appear in DCS Warranty Vehicle Inquiry or sales systems until 24-72 hours after they are announced, therefore AIR is always the recommended method for determining open campaigns and vehicle stops.

SITUATION

Stress corrosion cracks may occur on the studs of certain milled footrests from the BMW Motorrad special accessories catalog for the GS models. The following part numbers are affected:

- **77 25 2 452 958** Footrest adjustable, left, black solid
- **77 25 2 452 960** Footrest adjustable, right, black solid
- **77 25 2 465 256** Set of footrests adjustable, black solid



The original BMW Motorrad accessory footrests with the part numbers listed above are no longer offered and should no longer be sold. The footrests must be removed from the sales floor.

PROCEDURE

This Service Action only applies to certain Accessory Milled Footrests, part numbers are listed above. Check if the bike has these specific accessories; if they do not, no action is required. Customer vehicles coming in must be actively inspected for affected footrests that must be exchanged.

In the affected vehicles, the installed accessory footrests adjustable black solid must be exchanged with accessory footrests Shadow (Option 719).

Refer to the model-specific repair and installation instructions in AIR, e.g., "77 25 015 – Installing rider footrests adjustable"

PARTS INFORMATION

Part numbers R 1200/1250 GS/Adventure

46 71 9 829 537	Shadow footrest, left
46 71 9 829 532	Shadow footrest, right
46 71 9 829 535	Shadow footrest hinge, left
46 71 9 829 530	Shadow footrest hinge, right
46 71 8 526 107	Torsion spring (order 2x)

© 2021, BMW of North America, LLC. The contents of this document are confidential and should not be shared with third parties for distribution. All pricing subject to change.

Part numbers F 850 GS Adventure

46 71 9 829 537	Shadow footrest, left
46 71 9 829 532	Shadow footrest, right
46 71 9 829 535	Shadow footrest hinge, left
46 71 9 829 530	Shadow footrest hinge, right
46 71 8 526 107	Torsion spring (order 2×)

Part numbers F 750 GS, F 850 GS

46 71 9 829 537	Shadow footrest, left
46 71 9 829 532	Shadow footrest, right
46 71 9 829 535	Shadow footrest hinge, left
46 71 9 829 530	Shadow footrest hinge, right
46 71 8 526 107	Torsion spring (order 2×)

If Option 719 replacement part is not compatible for a specific VIN/Model, contact TSARA for additional replacement options/information.

WARRANTY INFORMATION

When submitting a warranty claim, please select Type 2 for parts warranty.

Defect code

77 25 90 00 00	Replacing optional accessories footrests adjustable
----------------	---

Labor Operation

00 60 393	Replacing rider footrests	3 FRU
+00 60 893	Replacing rider footrests	2 FRU
46 52 510	Removing and installing the rear-wheel stand special tool (motorcycles without center stand)	1 FRU

FRUs includes all repair procedures to complete the task with allowance for necessary ancillary tasks (e.g., visual inspection, lubrication, cleaning parts etc.) and administrative tasks.

Labor operation code 00 60 393 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation instead.

QUESTIONS REGARDING THIS BULLETIN

Technical inquiries	Contact the BMW Technical Support Group via TSARA
Warranty inquiries	Submit an IDS ticket to the Warranty Department
Parts inquiries	Submit an IDS ticket to the Motorrad Parts Department