


**Subject: Unwanted Front Windshield Wiper Swipe, Cruise Control Will Not Turn On, Steering Wheel Controls Inoperative, DTCs P155A SYM00, P1529 SYM03**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2019	2020	—	—	All	All
Chevrolet	Trax						

<b>Involved Region or Country</b>	North America
<b>Condition</b>	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> <li>• Unwanted front windshield swipe upon starting or powering up the vehicle.</li> <li>• Front wipers will not park.</li> <li>• Steering wheel controls inoperative or erratic operation.</li> <li>• Upon a vehicle scan check, DTCs P155A SYM00, P1529 SYM03 might be stored current or in history.</li> </ul>
<b>Cause</b>	 <p>5480325</p>

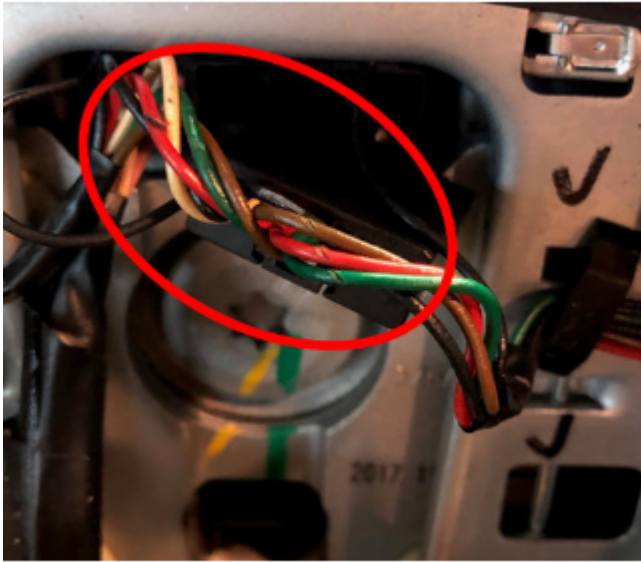

5480327

The cause of the condition may be the steering wheel harness shorted under the steering wheel inflator module.

**Correction**

If you encounter a vehicle with the above concern, inspect and repair the steering wheel harness referring to the proper wire repair procedures. Refer to *Wire to Wire Repair* in SI.

**Parts Information**

No parts are required for this repair.

**Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7486098*	Steering Wheel Harness Repair	0.6 hr
*This is a unique Labor Operation for bulletin use only.		

<b>Version</b>	1
<b>Modified</b>	Released November 03, 2021