

Rear Passenger Compartment Interior Lighting Nonfunctional

Topic number	LI82.20-P-073522
Version	1
Function group	82.20 - Interior lights
Date	8/25/21
Validity	Model series 223 with code 236 (Adaptive rear compartment lighting)
Reason for change	

Complaint

Rear lighting does not operate when switching on the rear passenger compartment interior lighting.

Cause

Faulty coding of component part control unit N10/6 (SAM-F).


Remedy


Perform SCN coding of component part control unit N10/6 (SAM-F).

Manually check reading light and interior lighting after coding.

1. Ignition is on (KL15)
2. Interior lighting is off
3. Operate reading light pushbutton switch (A) in grab handle lamp
=> reading light only goes on in grab handle lamp
4. Operate reading light pushbutton switch (A) in grab handle lamp again
=> Reading light only goes off in grab handle lamp
5. Operate favorites pushbutton switch (B) in grab handle lamp
=> Interior lighting goes on in both grab handle lamps + additional lamps
6. Operate favorites pushbutton switch (B) in grab handle lamp again
=> Interior lighting goes out in both grab handle lamps + additional lamps

!!! Use damage code 540P6/fault type 90 (software release) and document detailed customer complaint in the event of a warranty and goodwill claim!!!

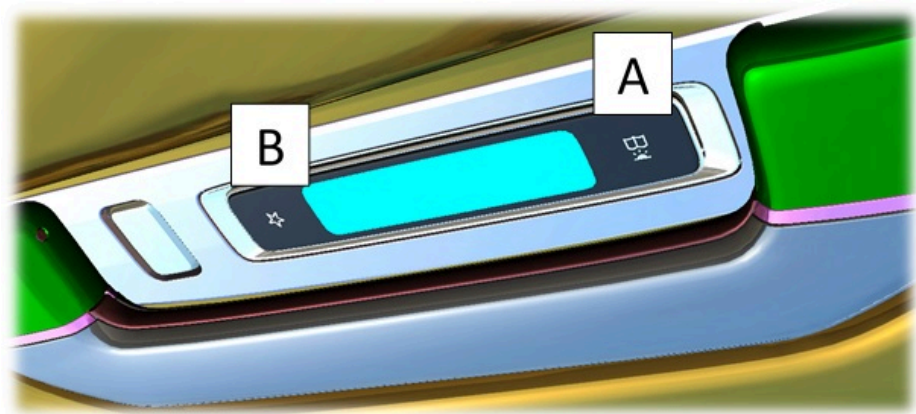

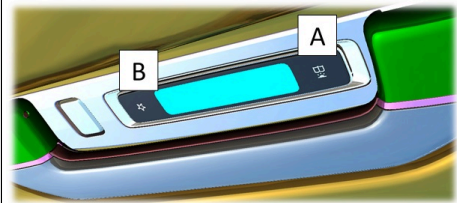Attachments	
File	Description
Leselicht_Innenbeleuchtung.jpg	
	

Symptoms
Lighting > Interior illumination > Interior lamp > Does not go on

XENTRY TIPS

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			540P690	