



Telematics Gateway (TGW2) Equipped Chassis Displaying Diagnostic Trouble Code (DTC) U000188 DL2 Data Erratic, Intermittent or Incorrect Troubleshooting



> Internal Content

Start evaluating the DL2 twisted pair wires from the TGW2 moving toward the Diagnostics Connector.

This is especially important if the TGW2 DL2 wire harness is installed as a wire pair overlay, (where it does not have any addition wire abrasion protection other than the plastic wire insulation). Gently pull the wires pair back and forth looking for any evidence of exposed wires on any sharp edges especially behind the Instrument Cluster and the metal edges on the steering column support frame.

If the issue is not found in this section of wiring the loop of CAN wires to and from an automatic transmission is the next area to be examined.



Tags

[k54063290](#)

[u000188](#)

[u010c](#)

[mid 142](#)

[volvo](#)

[mack](#)

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article



Live UI