




13 Liter Engines ONLY - Engine Coolant Pump Housing Leak; Coolant Found Around The Oil Cooler Duct Cover Or In Between The Coolant Pump Housing And Oil Cooler Housing - Model Years 2019 And 2020




> Internal Content

Vehicles affected by this issue will show coolant runoff on the front rights side of the engine. The likely area coolant will be found is highlighted below:

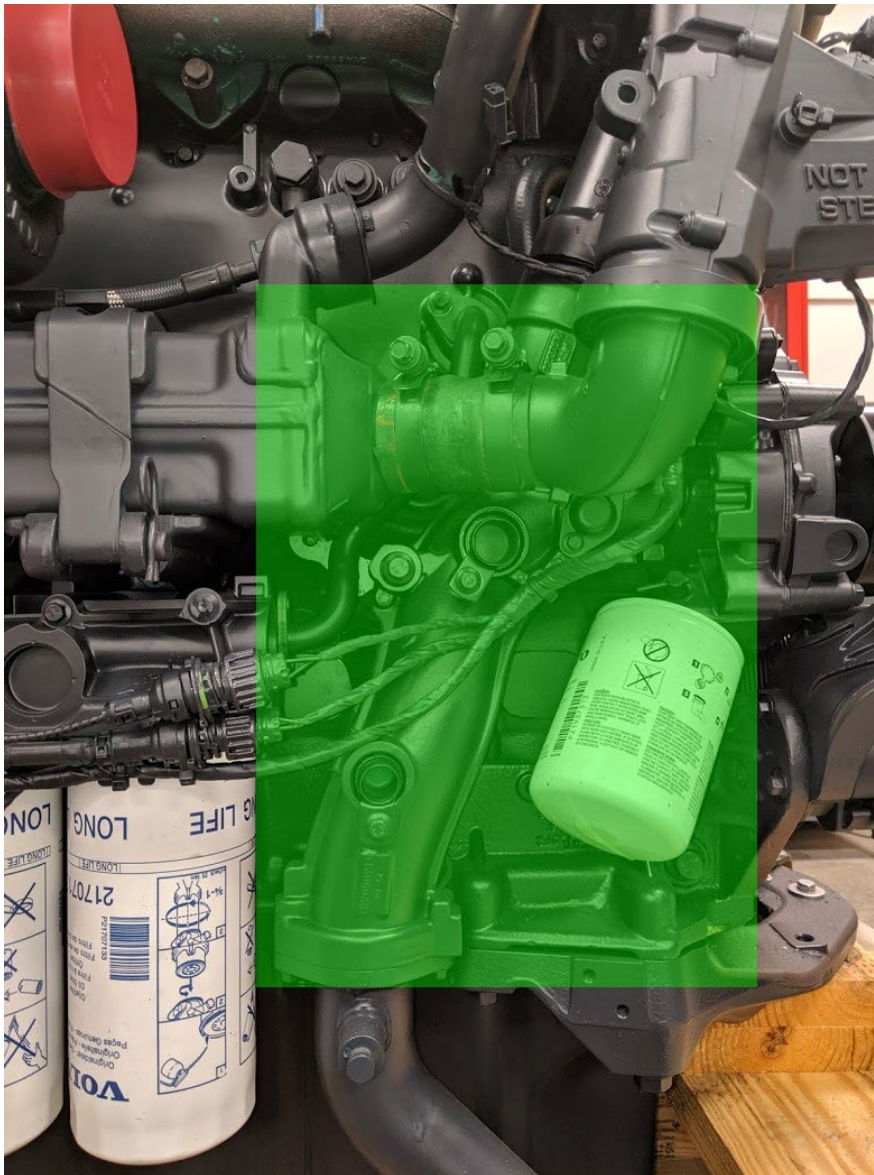

Live UI: The area in between the coolant pump housing and oil cooler duct cover should be checked:

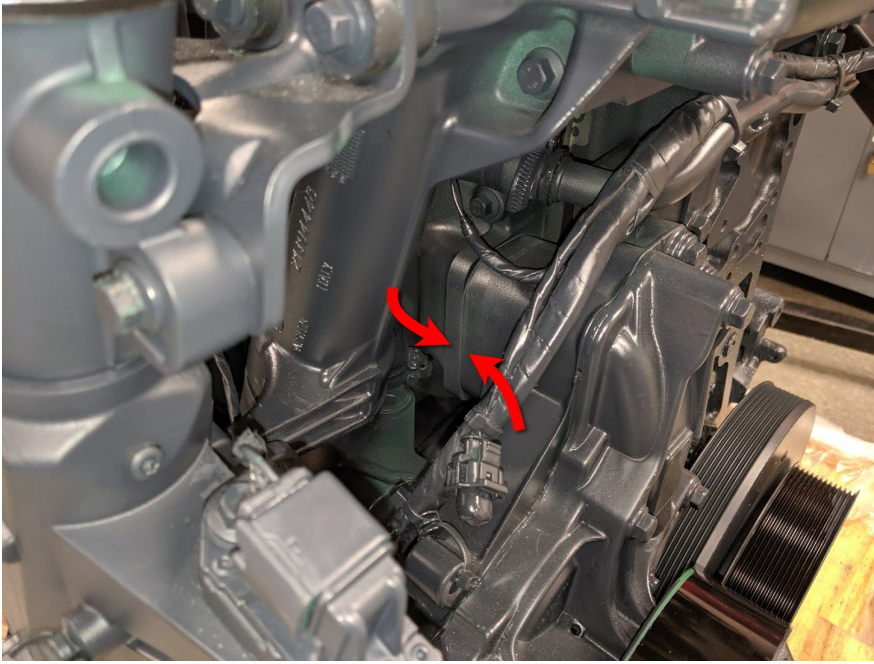

If a vehicle presents with a coolant leak in the area shown and the source of the leak is traced to the surfaces between the oil cooler duct cover and the coolant pump housing:

- Replace the coolant pump cover.
- Replace the seal between the oil cooler duct cover and the coolant pump.

Note: Ensure the seal is properly seated when reconnecting the housing and duct cover. If the seal is improperly seated, leakage may persist after repairs are complete.



Tags

[k05913580](#)

[volvo](#)

[mack](#)

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article