

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Document Information

Vehicles affected: P22: GT, P23: McLaren Speedtail, P26: McLaren Elva

Location: Electrical - Infotainment (ADI)

Concern: Instructions for how to update the Gen 2 ADI software

Condition: N/A

Measure

This article describes the procedure that must be used to update the software of the ADI system on McLaren GT.

USB Pen Drive Preparation:

1. Download the latest ADI software using this [link](#) and save the file into the local drive
2. Paste "ota_update.zip" direct onto USB key **still in .zip file**

Care Point: DO NOT EXTRACT THE FILES FROM THE .zip FOLDER.



Name	Type	Compressed size	Password ...	Size	Ratio
META-INF	File folder				
care_map	Text Document	1 KB	No	1 KB	0%
payload.bin	BIN File	1,840,170 KB	No	1,840,170 KB	0%
payload_properties	Text Document	1 KB	No	1 KB	0%

These are the files contained within "ota_update" folder that should now be on the USB pen drive.


Care Point: The USB pen drive must be formatted as FAT32

Care Point: The USB capacity must be between 4-8GB

Care Point: It is recommended the USB pen drive to have an activity LED light to allow monitoring the data transfer


Software Update Procedure

1. Insert the USB pen drive into the USB port in centre arm rest

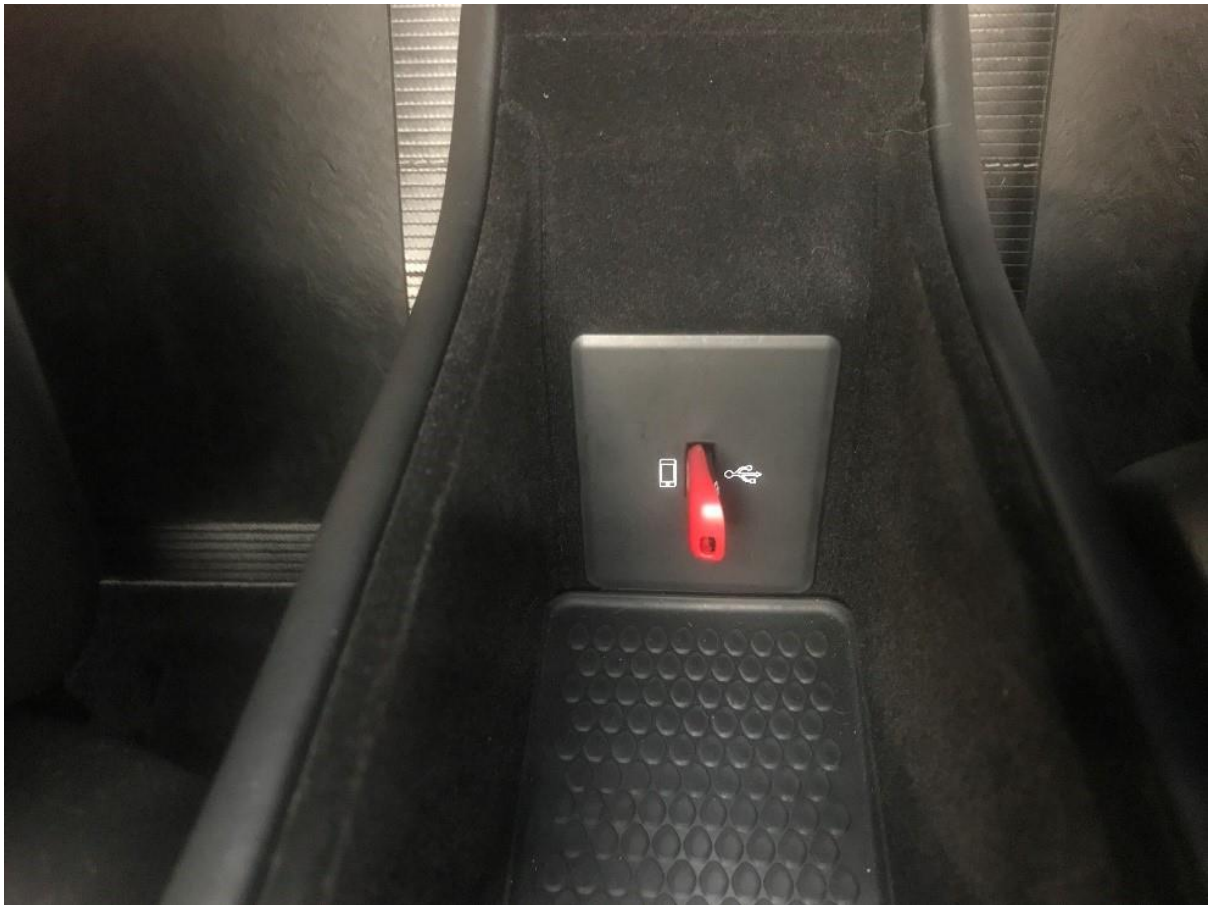


2. Select ADI and then Sequences


3. Select "USB Download" sequence

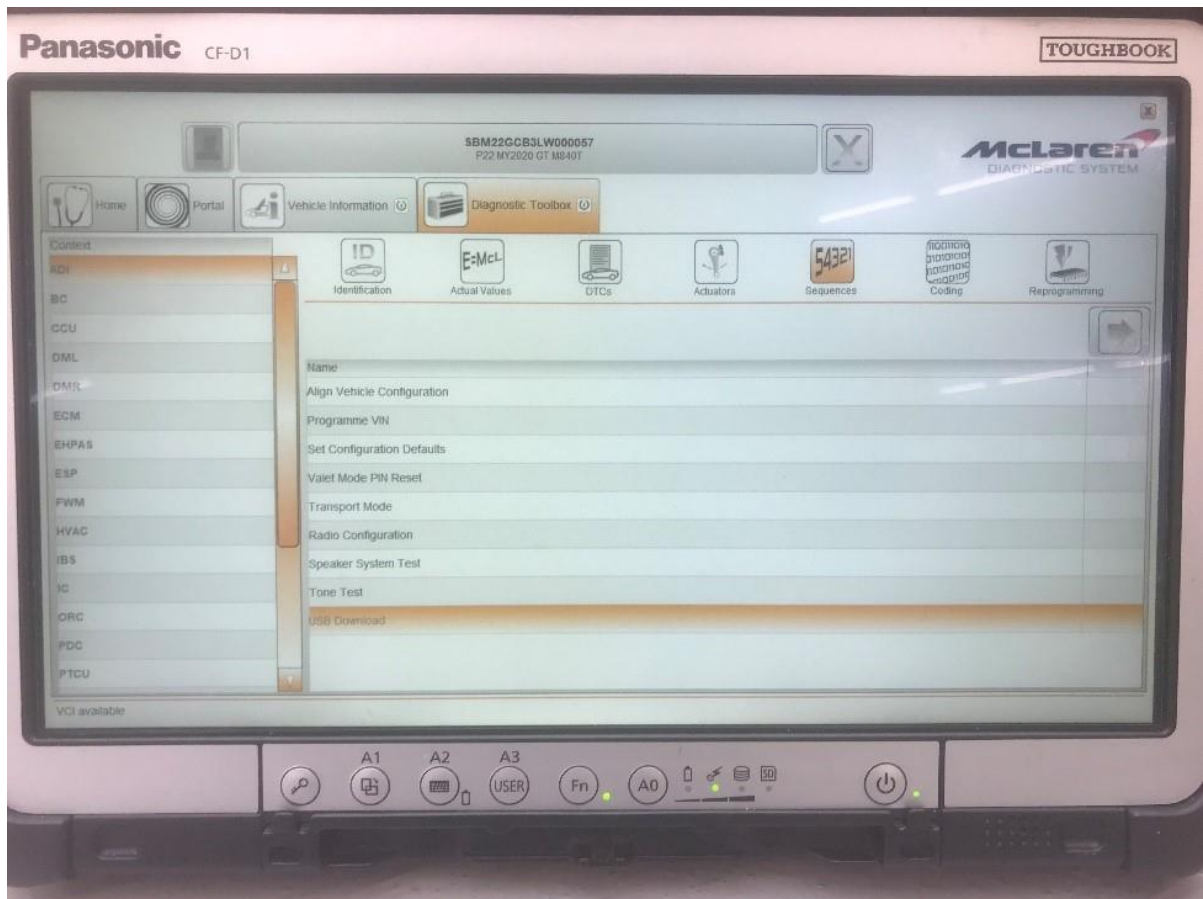

4. Within a minute, "Downloading" progress bar will be displayed in the central display

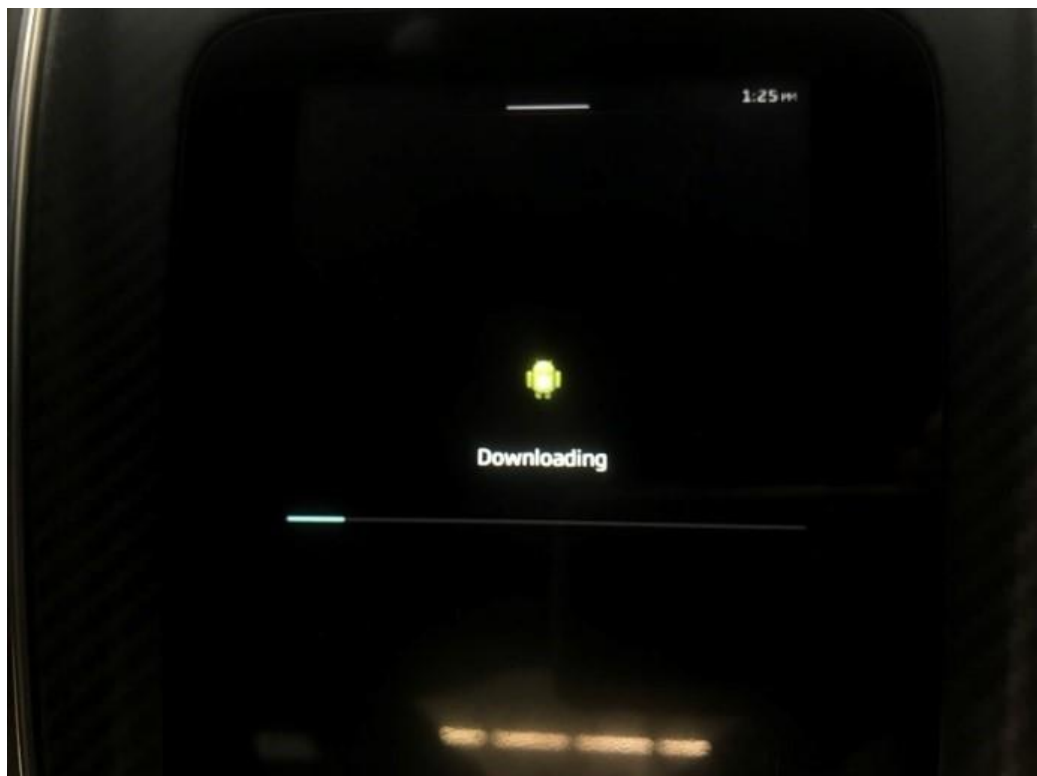


5. The MDS will display "USB Download - Please Wait - Download in Progress"

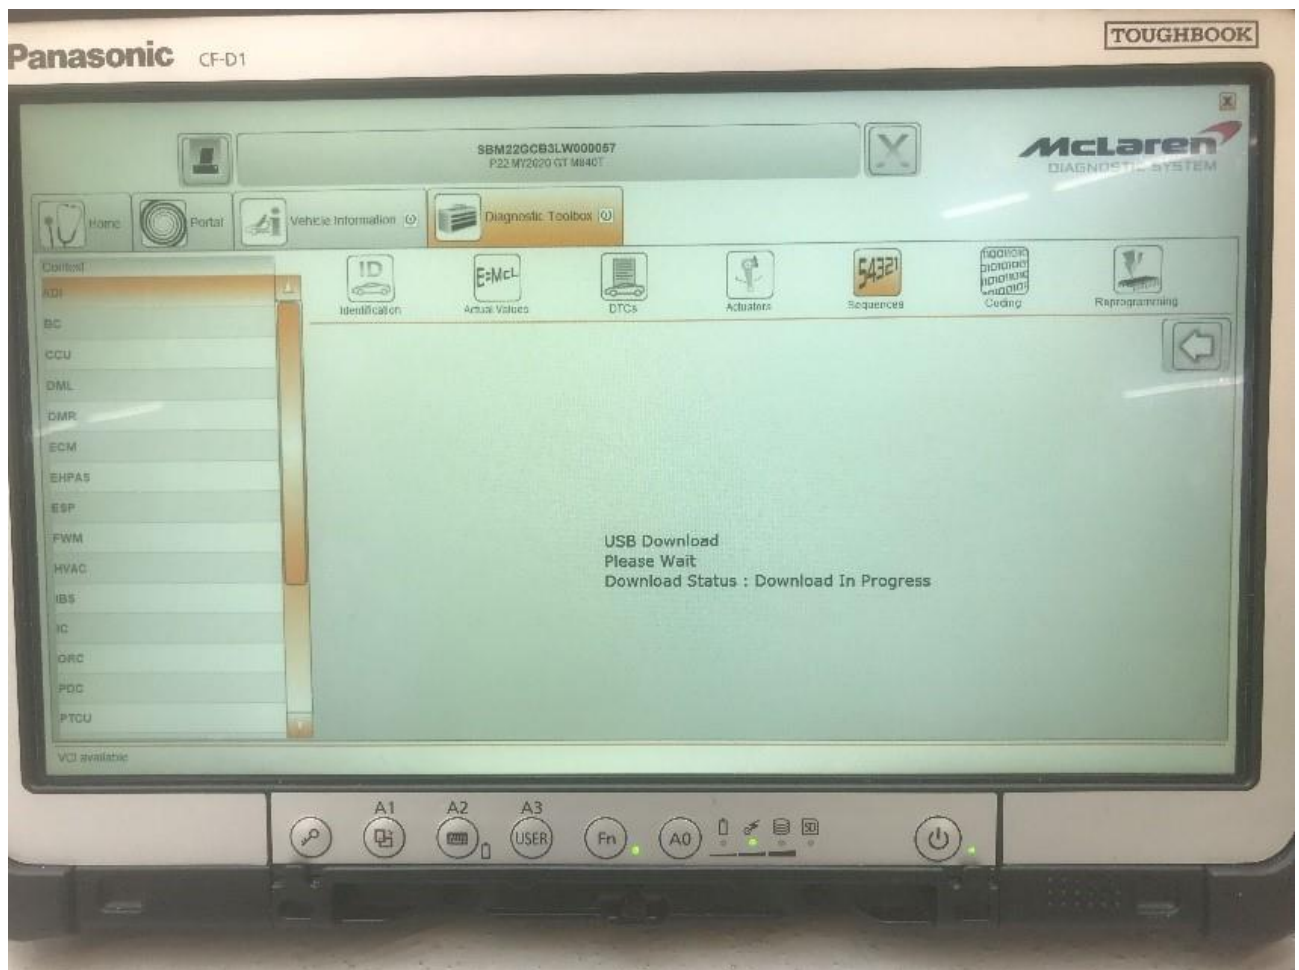


6. Wait up to approx. 15 minutes whilst software downloads. Various messages will appear in the central display

Care Point: Ignore any failure messages that may appear on the MDS screen during the software update


7. After the message has changed from "Downloading" to "Finalizing", ADI will self-reboot displaying black screen, then icons

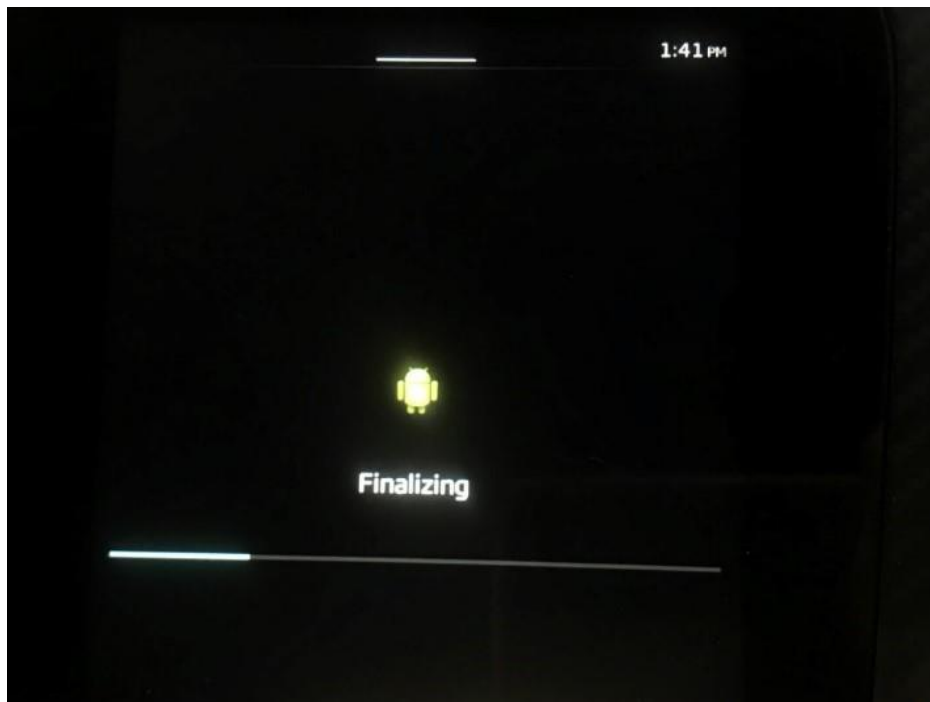

8. The central display now shows "Bundle Update"

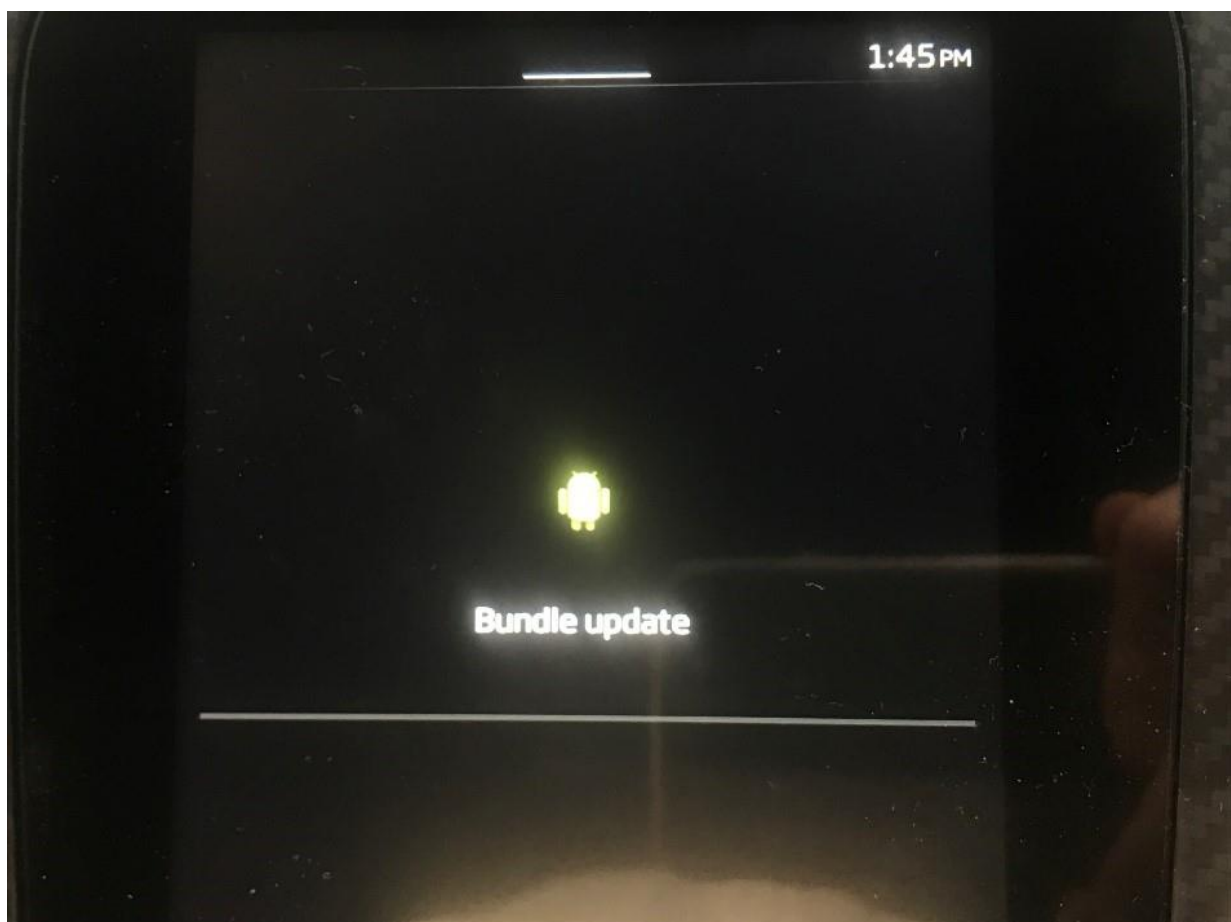

9. Wait another 2 to 5 minutes and the central display will show "Update Success"

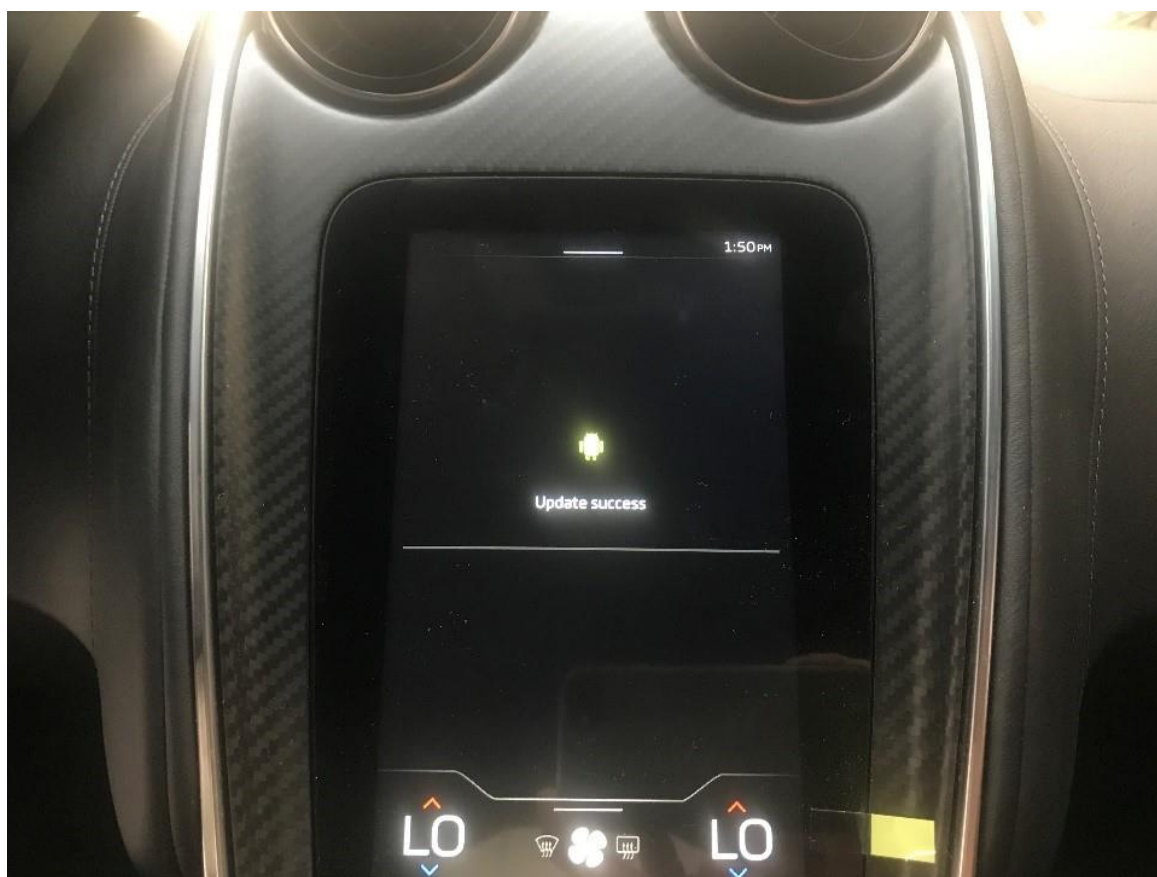

10. Press Centre button on the ADI, screen returns to settings

11. Check SW version installed as per screenshot below



12. Remove the USB key

- Once the update is complete, ensure all ADI functions are working as designed.

- Always refer to the Current Software Platform KA to ensure the rest of the vehicle (including Maps software) is aligned.
- If any issues during the update, please raise a Technical Request.

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.