

TECHNICAL TOPICS

POWERTRAIN



AJ20-P6 Poor Idle	MY19-22 Range Rover, RR Sport, Defender, Velar, F-Pace
<p>Customer Voice:</p> <ul style="list-style-type: none">Customer symptom of idle speed instability, RPM higher than expected, or check engine light illuminated and associated idle control system DTC's P0505, P0506, P0507 logged in PCM. <p>Technical Description:</p> <ul style="list-style-type: none">Positive Crankcase Ventilation breather membranes failing from a combination of mechanical stress and chemical attack from blow by gases. <p>Status:</p> <ul style="list-style-type: none">Guided diagnostics has been updated for P0507-00Please do not order the full breather cover assembly (LR164405/AJ814231), please order the Lower-Level Repair Kit (LR166809/AJ814239)Follow TOPIX section 303-08 - General Procedures - Positive Crankcase Ventilation System – Repair <p style="text-align: center;">Refer to SSM 75609 (LR), 75610 (J)</p>	

