



SERVICE BULLETIN

Classification: BT21-023	Reference: NTB21-116	Date: December 13, 2021
-----------------------------	-------------------------	----------------------------

PASSENGER FRONT DOOR GLASS SQUEAKS WHEN GOING UP AND DOWN

APPLIED VEHICLES: 2021 Rogue (T33)
APPLIED VIN AND DATE: VINs starting with **5N1** and built before September 15, 2021

IF YOU CONFIRM

The customer experiences an abnormal noise when operating the passenger (RH) side front door glass,

AND

The noise goes away when the glass is pressed inward from the outside of the vehicle.

ACTION

1. Replace the RH side Front Door Outside Molding.
2. Clean the RH side front door glass.
3. Confirm that the noise is no longer present.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Replace the RH side Front Door Outside Molding.
 - Refer to the ESM: **BODY EXTERIOR, DOORS, ROOF & VEHICLE SECURITY > EXTERIOR > REMOVAL AND INSTALLATION > DOOR OUTSIDE MOLDING**

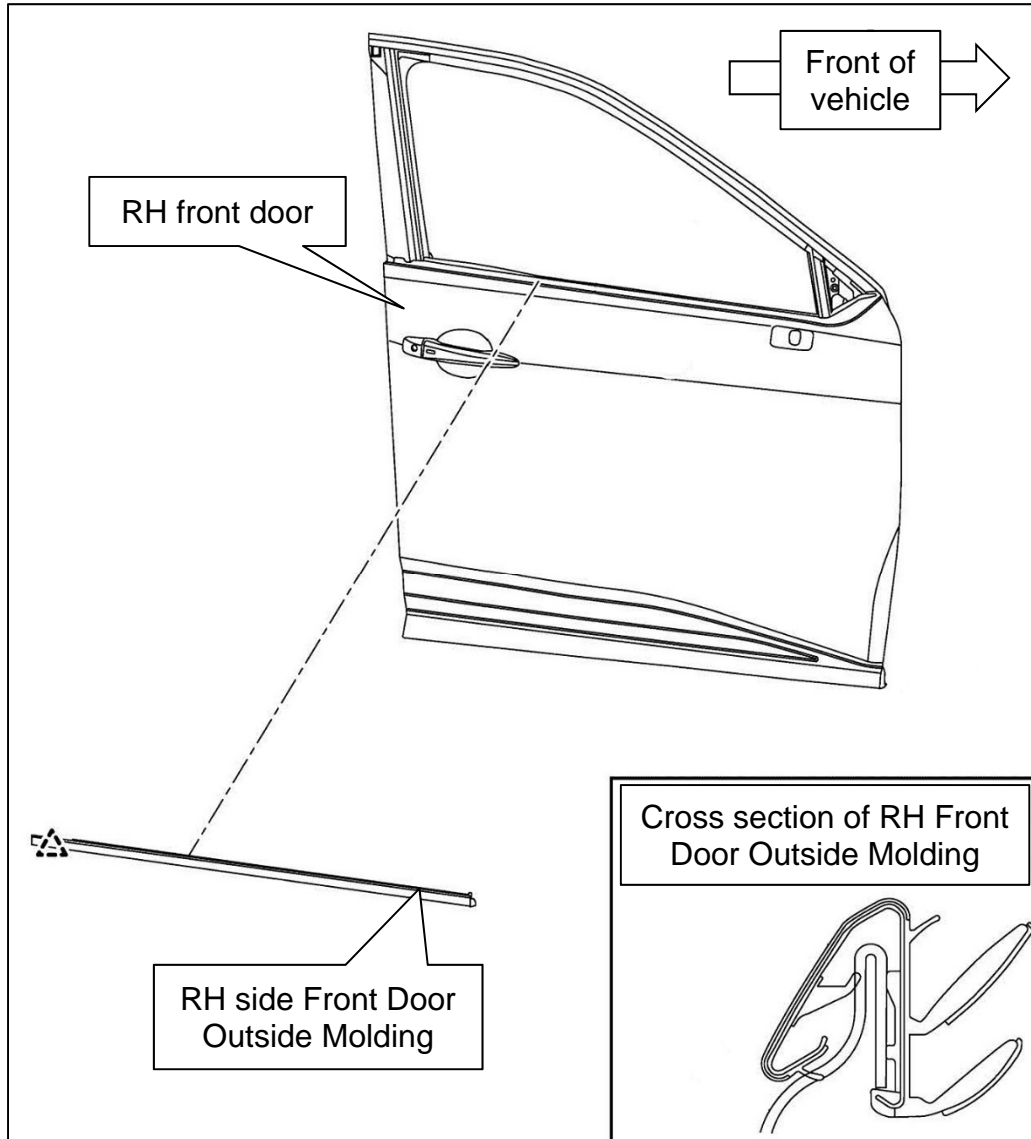


Figure 1

2. Clean the RH side front door glass.
3. Confirm that the noise is no longer present.

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Front Door Outside Molding (RH)	80820-6RA0A	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Outside Door Molding	(1)	UH16AA	ZL	32	(2)

- (1) Reference the electronic parts catalog and use the RH Outside Door Molding (80820-*****) as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (FRT).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
December 13, 2021	NTB21-116	Original bulletin published