



Technical Service Bulletin

Technical Service Bulletin: TSB210264**Released Date: 06-Dec-2021****Knock Sensor Circuit Fault Code 572 or 575**

Knock Sensor Circuit Fault Code 572 or 575

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISX12N CM2380 X120B

Issue Summary

Symptom:

- Active or inactive Fault Code 572 or 575
- Published troubleshooting is unable to identify the root cause of issue

Root Cause:

- Incorrect knock sensor circuit out of range diagnostic tuning in ECM calibration code revisions released between 29 August 2019 and 24 November 2021.

Verification

Verify Fault Code 572 and/or 575 is present.

Resolution

Compare the ECM code and revision number in the ECM to the calibration code revisions listed in the ECM Calibration Revision History Database on QuickServe® Online (QSOL) for applicable changes related to these fault codes.

Document History

Date	Details
2021-11-29	Module Created

Last Modified: 06-Dec-2021
