



## Preliminary Information

### PIT5874 Unable To Learn Front View Camera / No GDS2 Communication With Front View Camera Module (GDS Issue)

#### Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021	All	All	All	All
Chevrolet	Suburban	2021	All	All	All	All
Chevrolet	Tahoe	2021	All	All	All	All
GMC	Yukon Models	2021	All	All	All	All

Involved Region or Country	North America
Condition	Some technicians may comment that they cannot perform a front view camera learn or that they may not be able to use GDS2 to view data or DTC's in the front view camera module.
Cause	The cause of this condition could be an issue with GDS2.

#### Correction:

Engineering is aware of this issue and working on a GDS2 update. In the meantime, as a work-around, build the vehicle in GDS2 as a 2022 model year as follows:

- Connect MDI to the vehicle and computer
- Enter GDS2 in "Stand Alone Mode"
- Select "Diagnostics"
- At the next screen (Vehicle Selection screen), GDS2 will automatically pull the VIN and build the vehicle.
- While at the Vehicle Selection screen, press the "Clear Vehicle Selection" button, which is to the right of the VIN, as shown below. This will clear out the Year, Make and Model from GDS2 and then press enter.
- Select Model Year 2022, then the appropriate make and model.
- Select Module Diagnostics and B174W Frontview Camera – Windshield.
- If asked, Select High Content or Low Content, then Enter.
- Enter the needed area: Data Display, DTC, Configuration/Reset Functions to enter the the learn procedure, etc.

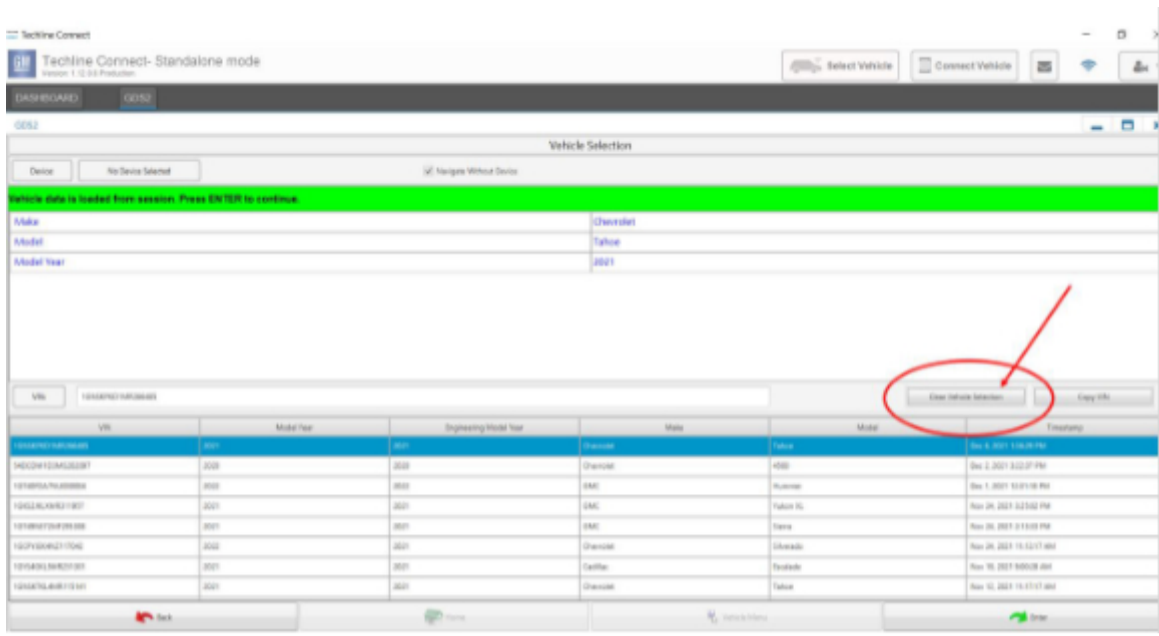

## Version History

Version	1
Modified	12/09/2021 - Created on.



© 2022 General Motors. All Rights Reserved.