

Service Bulletin

Bulletin No.: 21-NA-245

Date: December, 2021

TECHNICAL


Subject: Shift to Park Message Displayed in Driver Information Center (DIC)

Brand:	Model:	Model Year:		VIN:		Engino	Transmission:
		from	to	from	to	Engine:	(Automatic)
Chevrolet	Camaro	2016	2020	_	_	All	M5T, M5U, MF6, MI1, MI2, MI4, MGL

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Japan, GM Korea Company, China, Taiwan, Philippines
Condition	Some customers may comment on seeing that a Shift to Park message has appeared on the DIC screen.
Cause	The cause of the condition may be that the Park Switch is unable to pull the signal circuit low, telling the BCM it is electronically in Park.
Correction	Replace the transmission control assembly and install a jumper harness following the steps in the Service Procedure below.

Service Procedure

If you encounter a vehicle with the above concern, complete the following procedure:

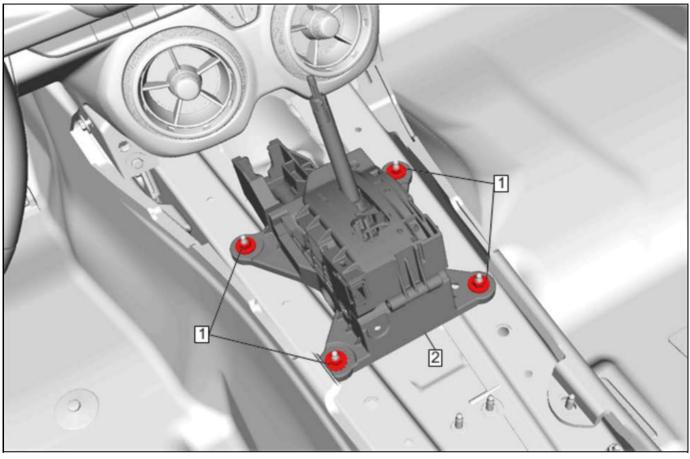

4165895


1. Remove the transmission control assembly from the vehicle. Refer to *Automatic Transmission Control Replacement* in SI.



5404694

Note: Ensure the jumper harness is not twisted or kinked.

2. Install the jumper harness between the shift control and the console body harness connector.

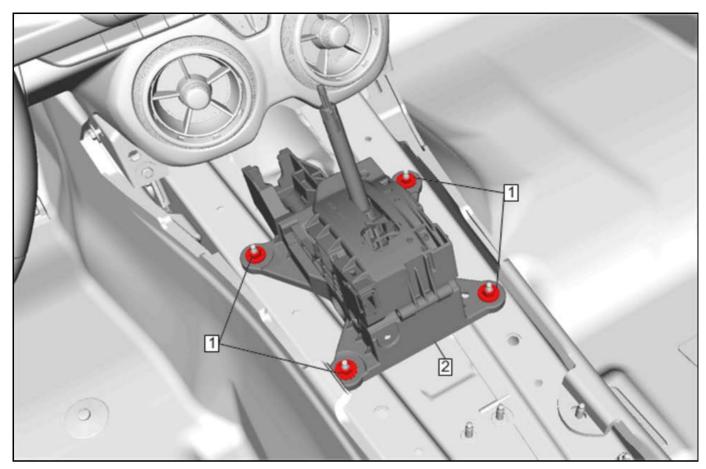

4165895

- 3. Install the new transmission control assembly. Refer to *Automatic Transmission Control Replacement* in SI.
- 4. Start the vehicle and verify that the Shift to Park message is NOT displayed.

Parts Information

Causal Part	Description	Part Number	Qty
Х	CONTROL ASM- A/TRNS	84588250	1
N/A	HARNESS ASM- A/TRNS CONT WRG (Jumper)	85102841	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8486068*	Transmission Control Assembly Replacement, Add Jumper Harness	0.9 hr
*This is a unique Labor Operation for bulletin use only.		

Version	1
Modified	Released December 17, 2021