

Technical product information

Topic	Instrument panel - diagnostic trouble code A00049/B200049
Market area	Bentley: worldwide (2WBE),Hongkong-Macau (5HK)
Brand	Bentley
Transaction No.	2042433/1
Level	EH
Status	Approval
Release date	

New customer code

Object of complaint	Complaint type	Position
Information, navigation, communication, entertainment -> Driver information system (DIS, MFI, MMI)	functionality	
Information, navigation, communication, entertainment -> Symbolic warning indicators -> Active-warning indicator	functionality -> activates	

New workshop code

Object of complaint	Complaint type	Position
Information, navigation, communication, entertainment -> Instrument cluster, displays, display panels -> Instrument cluster -> Instrument cluster warning lamp	functionality -> activates without reason	

Vehicle data

Mulsanne

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3Y2*	2013	E		*	*	*
3Y2*	2014	E		*	*	*
3Y2*	2015	E		*	*	*
3Y2*	2016	E		*	*	*

Chassis numbers

Manufacturer	Filler	Type	Filler	MY	Factory	From	To	Prod from	Prod to
SCB	***	**	*	*	*	017367	999999		

Documents

Document name
master.xml

Instrument panel - diagnostic trouble code A00049/B200049

Customer statement / workshop findings

ABS and or Air Bag warning light illuminated with no associated text in the Drivers' Instrument Panel

Technical background

A software anomaly in the Instrument panel, warning light check function, may cause warning light illumination when no system fault is present

Production change

Revised software developed

Measure

In the event of LED tell-tales illumination that may include ABS or Air Bag warning in the Drivers' Instrument Panel and Diagnostic Trouble Code (DTC) A00049 and or B200049 is reported and that DTC will not clear using service diagnostic tool then replace the Drivers' Instrument Panel

Rep. Gr. 90 Drivers instrument panel (DIP) (J285) – To remove and fit

Warranty accounting instructions

Normal warranty policies apply

Warranty Type	110 or 910
Labour Operation Code	90 25 19 00
Damage Service Number	90 25
Damage Code	02 02
Time	60TU

Parts information

Use FIVIN specific search in ETKA to identify the correct replacement part, all relevant replacement parts contain the revised software

Base part number for Drivers' Instrument Panel 3Y0920841