



NUMBER: 02-002-21

GROUP: 02 - Front Suspension

DATE: June 22, 2021

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

This Technical Service Bulletin has also been released as a Rapid Response Transmittal (RRT) 21-074, date of issue June 22, 2021. All applicable Sold and Un-Sold RRT VINs have been loaded. To verify this RRT service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RRT will expire 18 months after the date of issue.

SUBJECT:

Clunk or Scrape Noise From The Front Right Side of Vehicle

OVERVIEW:

This bulletin includes replacing the right front coil spring and lower shock bolt only.

MODELS:

2021 (JL) Jeep Wrangler

NOTE: This bulletin applies to vehicles within the following markets/countries: North America.

NOTE: This bulletin applies to vehicles built on or after February 06, 2021 (MDH 0206XX)

equipped with a 6.4L V8 SRT HEMI MDS Engine (Sales Code ESG).

SYMPTOM/CONDITION:

Customers may comment on the following:

A clunk or scrape noise coming from the front right side of the vehicle.

NOTE: Chipped paint on the tower and spring may also be noticeable.

PARTS REQUIRED:

Qty.	Part No.	Description
1	68481300AD	Spring, Front Coil
1	06104242AA	Bolt - Lower Shock
(AR)	68317791AA	Black Corrosion Resistant Protectant 4 Fl. Oz.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair procedure. **This RRT only applies to vehicles on the RRT VIN list.**

02-002-21 -2-

REPAIR PROCEDURE:

NOTE:

- Only replace the right front coil spring and lower shock bolt. Do not replace both front coils springs.
- If bare metal is noted on chassis tower; use Black Corrosion Resistant Protectant 4 Fl. Oz. P/N 68317791AA or equivalent, to touch up.
- 1. Remove and replace the front right spring and lower shock bolt. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info>02 Front Suspension / Front / Spring, Front Coil / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
02-27-01-9E	Right Front Coil Spring and Shock Bolt - Replace (1 - Semi-Skilled)	4 - Chassis	0.6 Hrs.

FAILURE CODE:

ZZ	Service Action