

GPOP - Issue Review System

Part Number: 68464872A\$

Part Description: MODULE, Transfer Case Control (DTCM)

Issue Description: If there are any ECU's being updated for Software updates this will cause an interruption in CAN communication which in combined with a shortened key cycle (CAN communication is still alive) can cause the C1472-92 DTCM Fault.

If Vehicle sets C1472-92 verify the diagnostics by the following:

(1.) Take Vehicle Scan to verify DTC is Active/Stored. Send to Tech Advisor to record DTC snapshot information.

If Vehicle sets C1472-92 verify the repair by the following:

- (1.) Verify there are no Ground loose connections / concerns (G910A) by ensuring the ground stud securement is correct.
- (2.) Complete sleep cycle. Allow DTCM to fully shutdown. PRDNL lights will no longer illuminate.
- (3.) After complete shutdown, turn ignition on and shift out of Park.
- (4.) Shift back into part and complete shutdown of ignition cycle