

GPOP - Issue Review System

Part Number: 04753183A\$, 05078564A\$, 04753538A\$, RL210327A\$, 68264741A\$, R8259595A\$, 68223854A\$, RL070538A\$, R8070538A\$, RL052759A\$, 05078684A\$, 68014103A\$, RL391404A\$, 05184285A\$, 68225979A\$, 05184251A\$, 68210327A\$, 06511385A\$, 68329056A\$, 68264479A\$, 04725981A\$, 68461214A\$, 68322458A\$, 68453637A\$, 68070538A\$, 04800696A\$, 68501446A\$, 68501447A\$, 68501448A\$

Part Description: Transmission,Trans Oil Pump,Torque Converter, Flexplate, Rear Seal, Engine

Issue Description: NOTE: FOR ALL PROMASTER (VF) 3.6L/62TE EQUIPPED VEHICLES: IF THE TRANSMISSION BRACKET TO THE TRANSMISSION CASE FASTENERS ARE REMOVED DURING SERVICING, THE FASTENERS (Part Number 06511385A\$) ARE ONE TIME USEAGE, AND MUST BE REPLACED, AND PROPERLY TORQUED TO 105 NM.

Vehicles built prior to 10/23/2015 requires Service Kit PN 68461214AA or 68501446AA; includes Transmission Isolator PN 68264483AA, and Adaptation Bracket 68264479AA, & Fastener Service Kit PN 68329056AA.

Vehicles built after on or after 10/23/2015 will require only the Fastener Service Kit PN 68329056AA or 68501448AA

For vehicle noise and flex plate found broken on vehicles > 50K miles.

- 1) Verify and Take pictures of the Trans/engine dowel pin holes, to see if the holes on trans bell housing are oblong, send pictures to FCA Redacted Content.
- 2) Call FCA Redacted Content, if no oblong holes are found to arrange trans swap and fast track the trans back to QEC.

If vehicle won't move and has noise/leaking from transmission bell housing area, check transmission pump bushing. If pump bushing is scored or damaged, replace the pump assembly as opposed to transmission.

If vehicle is jerking/slipping with MIL code(s) P0740 or P2764, check TCC Solenoid operation. If TCC Solenoid is ok, the codes are indicative of a torque converter failure. Replace the torque converter.

When replacing the long block engine, the VVT Actuator's PN 05184101A* must also be replaced. Engineering is requesting additional information when the long block engine is replaced due to thrust washer failures. Contact FCA Redacted Content.

~
 _____~
 Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.