



STAR ONLINE PUBLICATION




Case Number: S2108000188

Release Date: August 2021

Symptom/Vehicle Issue: ABS Antilock Brake System, ESC Electronic Stability Control, And EPB Electric Parking Brake Warning Lamps Or Service System Cluster Messages Displayed

Customer Complaint/Technician Observation: Owner complains of the cluster warning lamps that have come on. Technician observed multiple DTC's setting, C0508-00 Right Front Wheel Speed Sensor Circuit A, C2227-00 ABS Disabled ECU, U/Codes for Implausible data from the ABS module U0418, U140A, U0418-00, U0080-00.

Repair Procedure: Inspect the complete sensor wiring circuit from sensor through all retaining clips back to the ABS module. Repair the circuit or replace the sensor and wiring as required to complete. Example of sensor damaged wiring below.

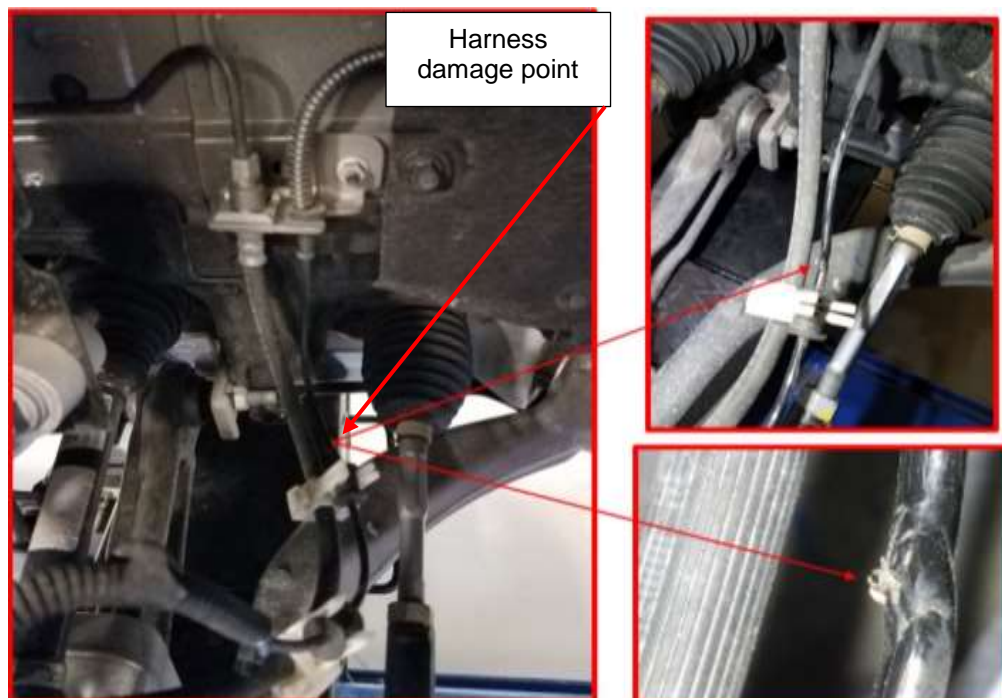

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found