



**NUMBER:** 08-144-21

**GROUP:** 08 - Electrical

**DATE:** August 26, 2021

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**This Technical Service Bulletin (TSB) has also been released as a Rapid Response Transmittal (RRT) 21-126, date of issue August 26, 2021. All applicable Sold and Un-Sold RRT VINs have been loaded. To verify this RRT service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RRT will expire 18 months after the date of issue.**

**SUBJECT:**

Flash: Hybrid Control Processor (HCP) and Auxiliary Hybrid Control Processor (AHCP) Updates

**OVERVIEW:**

This bulletin involves reprogramming the HCP and AHCP or also known as Power Inverter Module (PIM) with the latest available software.

**MODELS:**

2021 (JL) Jeep Wrangler

**NOTE:** This bulletin applies to vehicles within the following markets/countries: North America, EMEA and APAC.

**NOTE:** This bulletin applies to vehicles built on or before July 09, 2021 (MDH 0709XX) equipped with a 2.0L I4 DOHC DI Turbo PHEV Engine (Sales Code ECX).

**SYMPTOM/CONDITION:**

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the technician may find one or more of the following Diagnostic Trouble Code (DTC).

- P061B-00 - Internal Control Module Torque Calculation Performance.

**NOTE:** P061B-00 DTC may set after driving on snow/ice in 2WD and Traction Control System (TCS) turned off.

- P06A3-00 - Sensor Reference Voltage "D" Circuit/Open.
- P0697-00 - Sensor Reference Voltage 3 Circuit.

**NOTE:** Additional module flashes are required for this update to be effective, the following modules are all to be updated along with this HCP and AHCP update:

- Powertrain Control Module (PCM)
- Transmission Control Module (TCM).
- Battery Pack Control Module (BPCM).
- Integrated Dual Charging Module (IDCM).

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. If any vehicle not on the VIN list exhibits the symptom/condition or finds DTC stored, perform the repair.

**REPAIR PROCEDURE:**

**NOTE: The PCM, TCM, BPCM and IDCM must be updated to the latest available software at the conclusion of this repair procedure. Refer to all applicable published technical service bulletins for detailed repair procedures and labor times regarding updating the PCM, TCM, BPCM and IDCM software.**

**WARNING! Failure to update the PCM, TCM, BPCM and IDCM module following an HCP and AHCP software update may result in vehicle malfunctions.**

**NOTE: Install a battery charger to maintain a 12 volt system voltage.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Is the vehicle on the RRT VIN list?
  - YES>>> Proceed to [Step 2](#).
  - NO>>> Proceed to [Step 3](#).
2. Does the HCP and AHCP have the latest software already installed?
  - YES>>> This bulletin has been completed, use inspect LOP (18-19-86-9W) to close the active RRT.
  - NO>>> Proceed to [Step 3](#).
3. Reprogram the HCP and AHCP with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
4. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.
5. Verify the PCM, TCM, BPCM and IDCM are also programmed with the latest available software. Refer to all applicable published service bulletins for detailed repair procedures and labor times regarding updating the PCM, TCM, BPCM and IDCM software.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
18-19-86-9W	Hybrid Control Processor (HCP) and Auxiliary Hybrid Control Processor (AHCP) - Inspect (0 - Introduction)	1- Engine Repair and Performance	0.2 Hrs.
18-19-86-9X	Processor, Hybrid Control (HCP/AHCP) - Inspect and Reprogram (0 - Introduction)	1 - Engine Repair and Performance	0.6 Hrs.

**NOTE:** The expected completion time for the flash download portion of this procedure is approximately 18 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

**FAILURE CODE:**

The dealer must choose which failure code to use depending on if this is a Rapid Response Transmittal (RRT) or Service Bulletin.

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RRT.
- The failure code “RF” (Required Flash) can no longer be used on Service Bulletin flashes. **The “RF” failure code must be used on an RRT.**
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.

RF	Required Flash - RRT
CC	Customer Concern