



STAR ONLINE PUBLICATION



Case Number: S2108000058

Release Date: 02/26/2021

Symptom/Vehicle Issue: Right Front Turn Signal Bulb Does Not Illuminate DTC B163E-15 Front Right Turn Lamp Control-Circuit Short To Battery Or Open

Customer Complaint/Technician Observation: Owner complains that the right turn signal and or fog lamp bulbs are not illuminating. Technician observed DTC B163E-15 FRONT RIGHT TURN LAMP CONTROL-CIRCUIT SHORT TO BATTERY OR OPEN.

Repair Procedure: Inspect the headlamp & dash inline connector XY103A 24-way grey connector for a potential TPO (Terminal Push Out) for the involved circuit as shown in the example. Slightly move the connectors and or wires to identify any change. If terminal connection/wire is backed out of the connector, separate the connector, re-insert the terminal and secure the terminal within the connector. If the terminals cannot lock into place use connector repair kit 68309254AA to repair the involved terminals as needed – Harness replacement is not required.

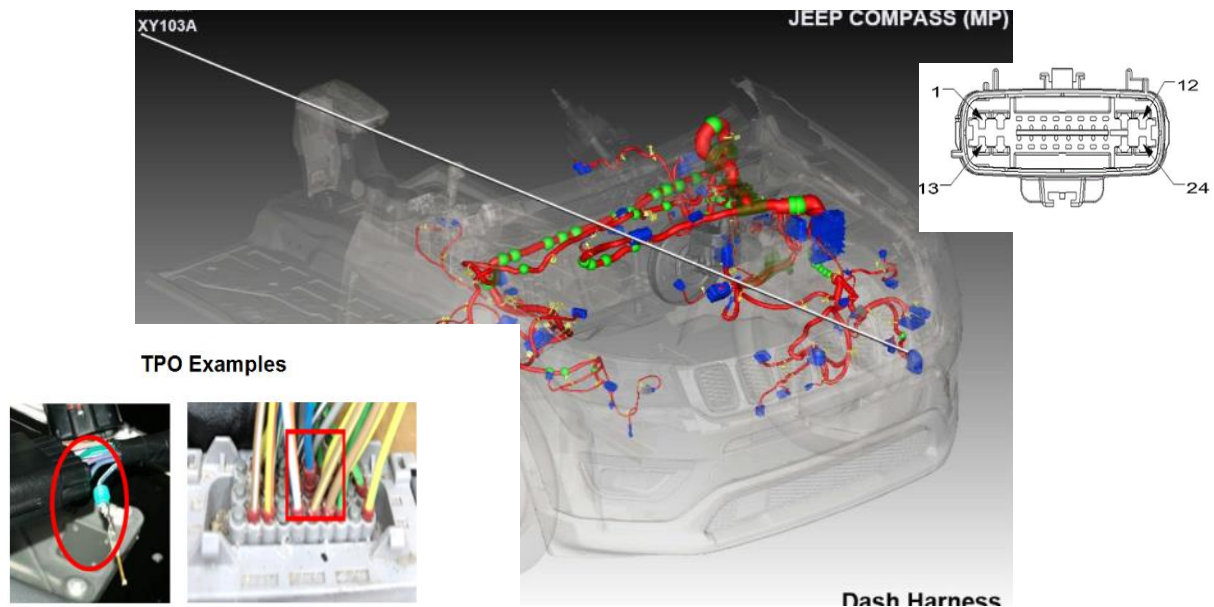


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found