



STAR ONLINE PUBLICATION





Case Number: S2105000002

Release Date: 3/16/2021

Symptom/Vehicle Issue: ESC ABS MIL light on DTC's P0507, P04FC, P2172 set

Customer Complaint/Technician Observation: ABS ESC (stability control) warning lamps illuminated. WiTECH may show P0507 IDLE SPEED PERFORMANCE HIGHER THAN EXPECTED, P04FC CRANKCASE VENTILATION SYSTEM PERFORMANCE and P2172 HIGH AIRFLOW/VACUUM LEAK DETECTED.

Discussion: Inspect the vacuum hose connections at the vacuum pump and intake manifold quick release connectors. Push the fitting on and feel/listen for an audible click. If the connections were positively locked, inspect the seals in the fittings and the tubes for damage. Replace the vacuum hose if damage is found. See below for reference.

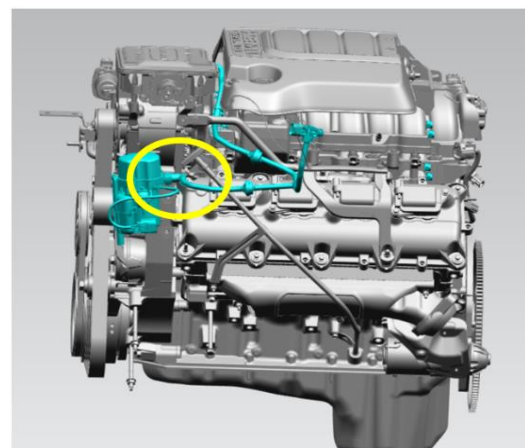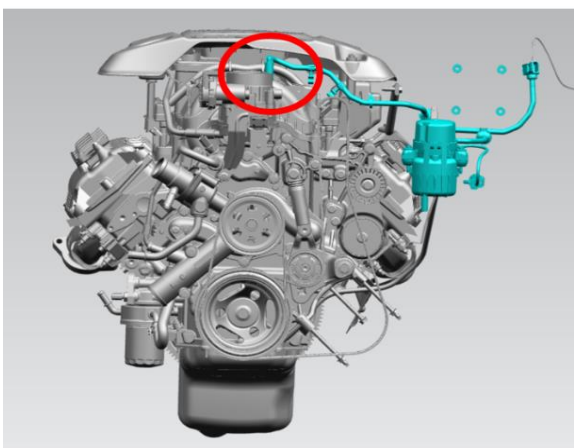

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found