



STAR ONLINE PUBLICATION



Case Number: S2108000057 – Rev. A

Release Date: 3/19/2021

Symptom/Vehicle Issue: The EVIC Splash Screen Does Not Display The Rubicon Logo On Vehicles Equipped With The Rubicon Recon 28Y Package

Discussion: The customer may report the EVIC displays the wrong splash screen at key on, and the splash screen displayed is not for a Rubicon. This issue will only be present on vehicles equipped with the Rubicon Recon 28Y package. Vehicles with the 2TR, 2TZ, 2TV Rubicon packages will display the correct Rubicon splash screen.

Diagnosis: Switch the ignition on and verify that the EVIC does not display the Rubicon splash screen.

Repair: To enable the Rubicon splash Screen on Rubicon Recon 28Y package vehicles. Using WiTech, select the vehicle then navigate to Guided Diagnostics in the left column. Perform a “Restore Vehicle Configuration” routine. Switch the ignition off and allow the vehicle to go to sleep. After the sleep cycle, switch the ignition on and confirm the Rubicon splash screen is now being displayed in the Clusters EVIC.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found