



## STAR ONLINE PUBLICATION




**Case Number:** S2108000100

**Release Date:** April 2021

**Symptom/Vehicle Issue:** CEL (Check Engine Lamp) Lamp On, Crank No Start, DTC U0109, U016C Lost Communications With Fuel Pump Module

**Customer Complaint/Technician Observation:** Owner complaint, check engine lamp is on. Technician observed DTC's U0109 and U016C Lost Communication With Fuel Pump Module, U11FB-00, U11FB-00 Lost Communication With Left Blind Spot Sensor.

**Repair Procedure:** With the above codes setting at the same time, inspect the left frame ground location G803A for any loose or damaged connections. Clean and secure the location to complete, no parts required Fig 1, 2.

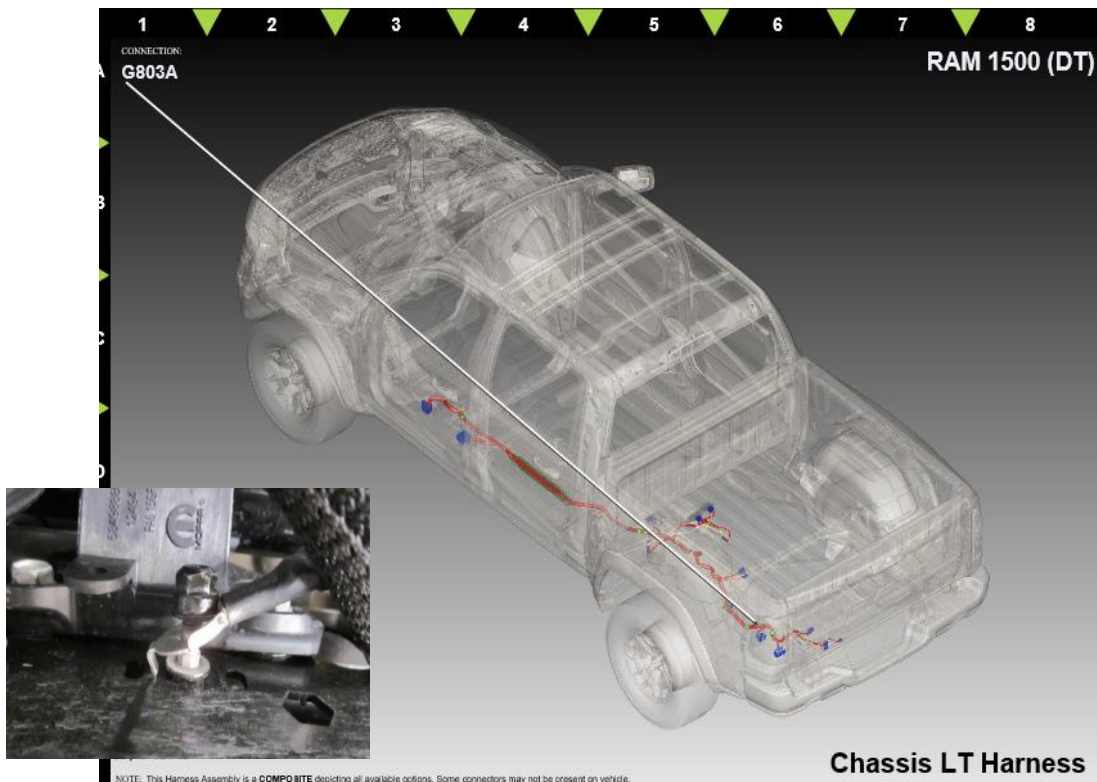

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action. 04.24.21

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**